# Standard Test Method for Plane-Strain Fracture Toughness of Metallic Materials<sup>1</sup>

This standard is issued under the fixed designation E 399; the number immediately following the designation indicates the year of original adoption or, in the case of revision, the year of last revision. A number in parentheses indicates the year of last reapproval. A superscript epsilon (c) indicates an editorial change since the last revision or reapproval.

This standard has been approved for use by agencies of the Department of Defense. Consult the DoD Index of Specifications and Standards for the specific year of issue which has been adopted by the Department of Defense.

1. Scope 1.1 This test method covers the determination of the stane-strain fracture toughness  $(K_{lc})$  of metallic materials by sets using a variety of fatigue-cracked specimens having a mackness of 0.063 in. (1.6 mm) or greater. The details of the strious specimen and test configurations are shown in annexes A1 through A7 and A9.

NOTE 1—Plane-strain fracture toughness tests of thinner materials at are sufficiently brittle (see 7.1) can be made with other types of eximens (1).<sup>3</sup> There is no standard test method for testing such thin saterials.

1.2 This test method also covers the determination of the excimen strength ratio  $R_{sx}$  where x refers to the specific perimen configuration being tested. This strength ratio is a function of the maximum load the specimen can sustain, its attal dimensions and the yield strength of the material.

1.3 Measured values of plane-strain fracture toughness stated in inch-pound units are to be regarded as standard.

1.4 This test method is divided into two main parts. The first part gives general information concerning the recommendations and requirements for  $K_{lc}$  testing. The second part is composed of annexes that give the displacement gage design, fatigue cracking procedures, and special requirements for the various specimen configurations covered by this method. In addition, an annex is provided for the specific procedures to be followed in rapid-load plane-strain fracture aughness tests. General information and requirements common to all specimen types are listed as follows:

	Sections
Aderenced Documents	2
Terminology	3
Stress-Intensity Factor	3.1.1
Plane-Strain Fracture Toughness	3.1.2
hummary of Test Method	4
Significance and Use	5

This test method is under the jurisdiction of ASTM Committee E-8 on facture and is the direct responsibility of Subcommittee E08.07 on uncar-Elastic Fracture.

Current edition approved Nov. 30, 1990. Published April 1991. Originally Mished as E 399 - 70 T. Last previous edition E 399 - 83.

<sup>3</sup> For additional information relating to the fracture toughness testing of alumi-4-m alloys, see Method B 645.

The boldface numbers in parentheses refer to the list of references at the end of this test method.

Precautions         5.1.1 to           Practical Applications         5.2           Apparatus         6           Loading Fixtures         6.2           Displacement Gage Design         Annex           Displacement Measurements         6.3           Specimen Size, Configurations, and Preparation         7	
Apparatus         6           Loading Fixtures         6.2           Displacement Gage Design         Annex           Displacement Measurements         6.3	<b>A</b> 1
Loading Fixtures 6,2 Displacement Gage Design Annex Displacement Measurements 6,3	<b>A</b> 1
Displacement Gage Design Annex Displacement Measurements 6.3	<b>A</b> 1
Displacement Measurements 6.3	A f
•	M.I
Specimen Size, Configurations, and Preparation 7	
Specimen Size Estimates 7.1	
Standard and Alternative Specimen Configurations 7.2	
Forms of Fatigue Crack Starter Notch 7.3.1	
Fatigue Cracking Annex	A2
Crack Extension Beyond Starter 7,3.2.2	
Measurements before Testing	
Thickness 8.2.1	
Width 8.2.3	
Starter Notch Root Radius 7.3.1	
Specimen Testing	
Loading Rate 8.3	
Test Record 8.4	
Measurements after Testing	
Crack Length 8.2.2	
Crack Plane Angle 8.2.4	
Calculation and Interpretation of Results 9	
Analysis of Test Record 9.1	
Validity Requirements on $P_{\text{max}}/P_O$ 9.1.2	
Validity Requirements on Specimen Size 9.1.3	
Crack Plane Orientation Designations 9.2	
Fracture Appearance Descriptions 9.3	
Reporting 10	
Precision and Bias	
Special Requirements for Rapid Load $K_{lc}(t)$ Tests Annex	<b>A</b> 7

1.5 Special requirements for the various specimen configurations appear in the following order:

Bend Specimen $SE(B)$	Annex A3
Compact Specimen C(T)	Annex A4
Arc-Shaped Tension Specimen A(T)	Annex A5
Disk-Shaped Compact Specimen DC(T)	Annex A6
Arc-Shaped Bend Specimen A(B)	Annex A9

1.6 This standard does not purport to address all of the safety concerns, if any, associated with its use. It is the responsibility of the user of this standard to establish appropriate safety and health practices and determine the applicability of regulatory limitations prior to use.

### 2. Referenced Documents

2.1 ASTM Standards:

E 8 Test Methods for Tension Testing of Metallic Materials<sup>4</sup>

<sup>4</sup> Annual Book of ASTM Standards, Vol 03.01.

- E 337 Test Method for Measuring Humidity with a Psychrometer (the Measurement of Wet- and Dry-Bulb Temperatures)<sup>5</sup>
- E 338 Test Method of Sharp-Notch Tension Testing of High-Strength Sheet Materials<sup>4</sup>
- E 616 Terminology Relating to Fracture Testing<sup>4</sup>

## 3. Terminology

- 3.1 Definitions— Terminology E 616 is applicable to this test method.
- 3.1.1 stress-intensity factor, K,  $K_1$ ,  $K_2$ ,  $K_3$  [FL<sup>-3/2</sup>]—the magnitude of the ideal-crack-tip stress field (a stress-field singularity) for a particular mode in a homogeneous, linear-elastic body.
- 3.1.1.1 Discussion—Values of K for modes 1, 2, and 3 are given by:

$$K_1 = \lim_{r \to \infty} [\sigma_r(2\pi r)^{1/2}],$$

$$K_2 = \lim_{r \to \infty} [\tau_{xy} (2\pi r)^{1/2}],$$
 and

$$K_3 = \lim_{r \to 0} [\tau_{yz} [\pi_{yz} (2\pi r)^{1/2}],$$

where r = a distance directly forward from the crack tip to a location where the significant stress is calculated.

- 3.1.1.2 Discussion—In this test method, mode 1 is assumed.
- 3.1.2 plane-strain fracture toughness—the crack-extension resistance under conditions of crack-tip plane strain.
- 3.1.2.1 Discussion—For example, in mode 1 for slow rates of loading and negligible plastic-zone adjustment, plane-strain fracture toughness is the value of stress-intensity factor designated  $K_{lc}$  [FL<sup>-3/2</sup>] as measured using the operational procedure (and satisfying all of the validity requirements) specified in this test method, which provides for the measurement of crack-extension resistance at the start of crack extension and provides operational definitions of crack-tip sharpness, start of crack extension, and crack-tip plane strain.
- 3.1.2.2 Discussion—See also definitions of crack-extension resistance, crack-tip plane strain, and mode.
- 3.1.2.3 Discussion—In this test method, mode 1 is assumed.
- 3.1.3 crack plane orientation—an identification of the plane and direction of a fracture in relation to product geometry. This identification is designated by a hyphenated code with the first letter(s) representing the direction normal to the crack plane and the second letter(s) designating the expected direction of crack propagation.
- 3.1.3.1 Discussion—The fracture toughness of a material usually depends on the orientation and direction of propagation of the crack in relation to the anisotropy of the material, which depends, in turn, on the principal directions of mechanical working or grain flow. The orientation of the crack plane should be identified wherever possible in accordance with the following systems (11). In addition, the product form should be identified (for example, straight-rolled plate, cross-rolled plate, pancake forging, etc.).

3.1.3.2 Discussion—For rectangular sections, the refer-

ence directions are identified as in Figs. 1 and 2, which give examples for a rolled plate. The same system would be useful for sheet, extrusions, and forgings with nonsymmetrical grain flow.

L = direction of principal deformation (maximum grain flow).

T = direction of least deformation, and

S =third orthogonal direction.

- 3.1.3.3 Discussion—Using a two letter code, the first letter designates the direction normal to the crack plane, and the second letter the expected direction of crack propagation. For example, in Fig. 1 the T-L specimen has a fracture plane whose normal is in the width direction of a plate and an expected direction of crack propagation coincident with the direction of maximum grain flow or longitudinal direction of the plate.
- 3.1.3.4 Discussion—For specimens that are tilted in respect to two of the reference axes, Fig. 2, the orientation is identified by a three-letter code. The code L-TS, for example, means that the crack plane is perpendicular to the direction of principal deformation (L direction), and the expected fracture direction is intermediate between T and S. The code TS-L means the crack plane is perpendicular to a direction intermediate between T and S, and the expected fracture direction is in the L direction.
- 3.1.3.5 Discussion—For certain cylindrical sections where the direction of principal deformation is parallel to the longitudinal axis of the cylinder, the reference directions are identified as in Fig. 3, which gives examples for a drawn bar. The same system would be useful for extrusions or forged parts having circular cross section.

L = direction of maximum grain flow,

R = radial direction, and

C = circumferential or tangential direction.

### 4. Summary of Test Method

- 4.1 This test method involves testing of notched spect mens that have been precracked in fatigue by loading either in tension or three-point bending. Load versus displacement across the notch at the specimen edge is recorded autograph ically. The load corresponding to a 2 % apparent increment of crack extension is established by a specified deviation from the linear portion of the record. The  $K_{Lc}$  value is calculated lated from this load by equations that have been established on the basis of elastic stress analysis of specimens of the type described in this method. The validity of the determination of the  $K_{lc}$  value by this test method depends upon the establishment of a sharp-crack condition at the tip of the fatigue crack, in a specimen of adequate size. To establish suitable crack-tip condition, the stress intensity level which the fatigue precracking of the specimen is conducted limited to a relatively low value.
- 4.2 The specimen size required for testing purposes in creases as the square of the ratio of toughness to yield strength of the material; therefore a range of proportion specimens is provided.

# 5. Significance and Use

5.1 The property  $K_{1c}$  determined by this test method

<sup>5</sup> Annual Book of ASTM Standards, Vol 11.03.


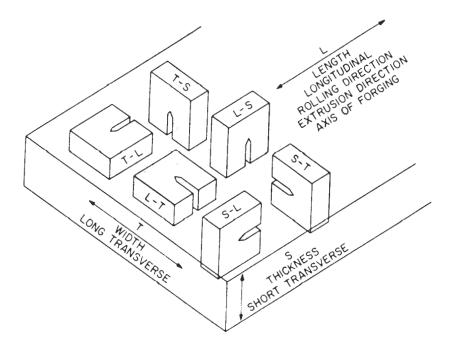


FIG. 1 Crack Plane Orientation Code for Rectangular Sections

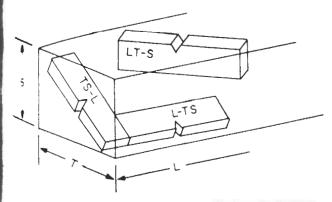

rg. 2 Crack Plane Orientation Code for Rectangular Sections
Where Specimens are Tilted with Respect to the Reference
Directions

deracterizes the resistance of a material to fracture in a eutral environment in the presence of a sharp crack under were tensile constraint, such that the state of stress near the sack front approaches tritensile plane strain, and the crackpplastic region is small compared with the crack size and common dimensions in the constraint direction. A  $K_{lc}$  value believed to represent a lower limiting value of fracture aughness. This value may be used to estimate the relation wween failure stress and defect size for a material in service elerein the conditions of high constraint described above sould be expected. Background information concerning the us for development of this test method in terms of linear ustic fracture mechanics may be found in Refs (1) and (2). 11.1 The  $K_{\rm LC}$  value of a given material is a function of sting speed and temperature. Furthermore, cyclic loads can use crack extension at  $K_1$  values less than the  $K_{1c}$  value. Tek extension under cyclic or sustained load will be inrased by the presence of an aggressive environment. There-

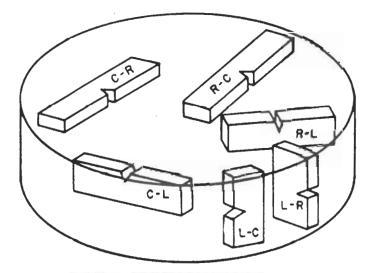


FIG. 3 Crack Plane Orientation Code for Bar and Hollow Cylinder

fore, application of  $K_{Ic}$  in the design of service components should be made with awareness to the difference that may exist between the laboratory tests and field conditions.

- 5.1.2 Plane-strain crack toughness testing is unusual in that there can be no advance assurance that a valid  $K_{Ic}$  will be determined in a particular test. Therefore it is essential that all of the criteria concerning validity of results be carefully considered as described herein.
- 5.1.3 Clearly it will not be possible to determine  $K_{Ic}$  if any dimension of the available stock of a material is insufficient to provide a specimen of the required size. In such a case the specimen strength ratio determined by this method will often have useful significance. However, this ratio, unlike  $K_{Ic}$  is not a concept of linear elastic fracture mechanics, but can be a useful comparative measure of the toughness of materials

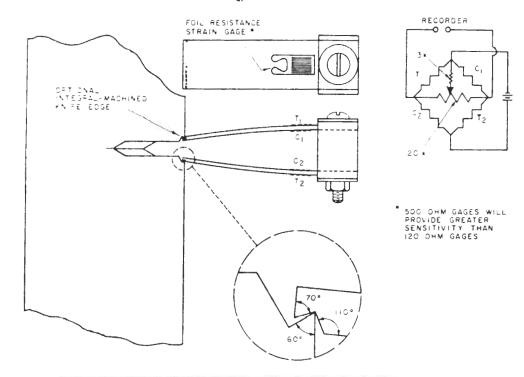


FIG. 4 Double-Cantilever Clip-In Displacement Gage Showing Mounting by Means of Integral Knife Edges (Gage Design Details are Given in Annex A1)


when the specimens are of the same form and size, and that size is insufficient to provide a valid  $K_{lc}$  determination, but sufficient that the maximum load results from pronounced crack propagation rather than plastic instability.

- 5.1.3.1 The strength ratio for center-cracked plate specimens tested in uniaxial tension may be determined by Test Method E 338.
  - 5.2 This test method can serve the following purposes:
- 5.2.1 In research and development to establish, in quantitative terms, significant to service performance, the effects of metallurgical variables such as composition or heat treatment, or of fabricating operations such as welding or forming, on the fracture toughness of new or existing materials.
- 5.2.2 In service evaluation, to establish the suitability of a material for a specific application for which the stress conditions are prescribed and for which maximum flaw sizes can be established with confidence.
- 5.2.3 For specifications of acceptance and manufacturing quality control, but only when there is a sound basis for specification of minimum  $K_{lc}$  values, and then only if the dimensions of the product are sufficient to provide specimens of the size required for valid  $K_{lc}$  determination. The specification of  $K_{lc}$  values in relation to a particular application should signify that a fracture control study has been conducted on the component in relation to the expected history of loading and environment, and in relation to the sensitivity and reliability of the crack detection procedures that are to be applied prior to service and subsequently during the anticipated life.

## 6. Apparatus

6.1 Loading—Specimens should be loaded in a testing machine that has provision for autographic recording of the load applied to the specimen.

- 6.2 Fixtures—Fixtures suitable for loading the specimen configurations covered by this method are shown in the appropriate annex. These fixtures are so designed as to minimize the frictional contributions to the measured load
- 6.3 Displacement Gage—The displacement gage output shall indicate the relative displacement of two precisely located gage positions spanning the crack starter notch mouth. Exact and positive positioning of the gage on the specimen is essential, yet the gage must be released without damage when the specimen breaks. A recommended design for a self-supporting, releasable gage is shown in Fig. 4 and described in Annex A1. The strain gage bridge arrangement is also shown in Fig. 4.
- 6.3.1 The specimen must be provided with a pair of accurately machined knife edges that support the gage arms and serve as the displacement reference points. These knife edges can be machined integral with the specimen as shown in Fig. 4 and Fig. 5 or they may be separate pieces fixed to the specimen. A suggested design for such attachable knife edges is shown in Fig. 6. This design is based on a knife edge spacing of 0.2 in. (5.1 mm). The effective gage length is established by the points of contact between the screw and the hole threads. For the design shown, the major diameter of the screw has been used in setting this gage length. A No. 2 screw will permit the use of attachable knife edges for specimens having W > 1 in. (25 mm).
- 6.3.2 Each gage shall be checked for linearity using as extensometer calibrator or other suitable device; the resettability of the calibrator at each displacement interval should be within +0.000020 in. (0.00050 mm). Reading shall be taken at ten equally spaced intervals over the working range of the gage (see Annex A1). This calibration procedure should be performed three times, removing and

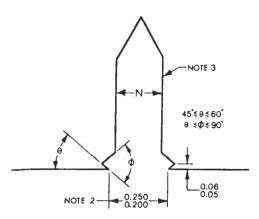


NOTE 1-Dimensions in inches.

NOTE 2— Gage length shown corresponds to clip gage spacer block dimengors shown in Annex A1, but other gage lengths may be used provided they are appropriate to the specimen (see 6.3.3).

NOTE 3—For starter notch configurations see Fig. 7.

in. 0.050 0.060 0.200 0.250 mm 1.3 1.5 5.1 6.4	

FIG. 5 Example of Integral Knife Edge Design

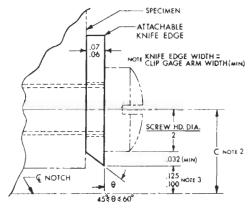

Note 1-Dimensions are in inches.

NOTE 2—Effective gage length =  $2C + \text{Screw Thread Diameter} \leq W/2$ . (This will always be greater than the gage length specified in A1.1.)

Note 3—Dimension shown corresponds to clip gage spacer block dimension in Annex A1.

Metric Equivalents					
in.	0.032	0.06	0.07	0.100	0.125
mm	0.81	1.5	1.8	2.54	3.18

FIG. 8 Example of Attachable Knife Edge Design

reinstalling the gage in the calibration fixture between each run. The required linearity shall correspond to a maximum deviation of +0.0001 in. (0.0025 mm) of the individual displacement readings from a least-squares-best-fit straight line through the data. The absolute accuracy, as such, is not important in this application, since the method is concerned with relative changes in displacement rather than absolute values (see 9.1).

6.3.3 It is not the intent of this method to exclude the use of other types of gages or gage-fixing devices provided the gage used meets the requirements listed below and provided the gage length does not exceed those limits given in the annex appropriate to the specimen being tested.

### 7. Specimen Size, Configurations, and Preparation

7.1 Specimen Size:

7.1.1 In order for a result to be considered valid according to this method it is required that both the specimen thickness, B, and the crack length, a, exceed 2.5  $(K_{\rm Ic}/\sigma_{\rm YS})^2$ , where  $\sigma_{\rm YS}$  is the 0.2 % offset yield strength of the material for the temperature and loading rate of the test (1, 5, 6).

7.1.2 The initial selection of a size of specimen from which valid values of  $K_{lc}$  will be obtained may be based on an estimated value of  $K_{lc}$  for the material. It is recommended that the value of  $K_{lc}$  be overestimated, so that a conservatively large specimen will be employed for the initial tests. After a valid  $K_{lc}$  result is obtained with the conservative-size initial specimen, the specimen size may be reduced to an appropriate size  $[a \text{ and } B \ge 2.5 (K_{lc}/\sigma_{YS})^2]$  for subsequent testing.

7.1.3 Alternatively, the ratio of yield strength to Young's modulus can be used for selecting a specimen size that will be adequate for all but the toughest materials:

$\sigma_{YS}\!\!/E$	Thickr	ecommended less and Length
	in.	mm
0.0050 to 0.0057	3	75
0.0057 to 0.0062	21/2	63
0.0062 to 0.0065	2	50
0.0065 to 0.0068	13/4	44
0.0068 to 0.0071	1 1/2	38
0.0071 to 0.0075	11/4	32
0.0075 to 0.0080	1	25
0.0080 to 0.0085	3/4	20
0.0085 to 0.0100	1/2	121/2
0.0100 or greater	1/4	61/2


When it has been established that  $2.5 (K_{Ic}/\sigma_{YS})^2$  is substantially less than the minimum recommended thickness given in the preceding table, then a correspondingly smaller specimen can be used. On the other hand, if the form of the available material is such that it is not possible to obtain a specimen with both crack length and thickness greater than  $2.5 (K_{Ic}/\sigma_{YS})^2$ , then it is not possible to make a valid  $K_{Ic}$  measurement according to this method.

7.2 Specimen Configurations—The configurations of the various specimens are shown in the following annexes: Annex A3, Bend Specimen SE (B); Annex A4, Compact Specimen C (T); Annex A5, Arc-Shaped Tension Specimen A (T); Annex A6, Disk-Shaped Compact Specimen DC (T); and Annex A9, Arc-Shaped Bend Specimen A(B).

7.2.1 Standard Specimens—The crack length, a (crack starter notch plus fatigue crack) is nominally equal to the thickness, B, and is between 0.45 and 0.55 times the width, W. The ratio W/B is nominally equal to two.

7.2.2 Alternative Specimens—In certain cases it may be desirable to use specimens having W/B ratios other than two. Alternative proportions for bend specimens are  $1 \le W/B \le 4$ . For the other specimen configurations alternative specimens may have  $2 \le W/B \le 4$ . These alternative specimens shall have the same crack length-to-width ratio as the standard specimens. It should be appreciated that  $K_{Ic}$  values obtained using alternative specimen proportions may not agree with those obtained using the standard specimens (15).

7.3 Specimen Preparation—The dimensional tolerances and surface finishes shown on the specimen drawings given

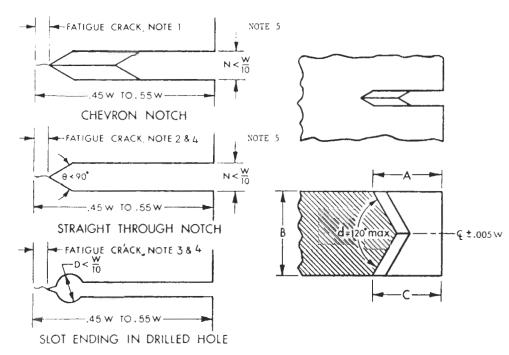

(a) Starter Notches and Fatigue Cracks

Note 1—For a chevron crack starter notch the fatigue crack shall emerge on both surfaces of the specimen.

NOTE 2—Fatigue crack extension on each surface of the specimen containing a straight-through notch shall be at least 0.025 W or 0.050 in. (1.3 mm), whichever is larger.

Note 3—Fatigue crack extension on each surface of the specimen from the stress raiser tipping the hole shall be at least 0.5 D or 0.050 in. (1.3 mm), whichever is larger.

NOTE 4—Crack starter notch shall be perpendicular to the specimen surfaces and to the intended direction of crack propagation within ±2°.

NOTE 5-Notch width N need not be less than 1/16 in. (1.6 mm).

(b) Detail of Chevron Notch

Note 1-A = C within 0.010 W

Note 2—Cutter tip angle 90° max

Note 3—Radius at chevron notch bottom 0.010 in. (0.25 mm) max

FIG. 7 Crack Starter Notch and Fatigue Crack Configurations

in Annexes A3 to A6 and A9 shall be followed in specimen preparation.

7.3.1 Fatigue Crack Starter Notch—Three forms of fatigue crack starter notches are shown in Fig. 7. To facilitate fatigue cracking at low stress intensity levels, the root radius for a straight-through slot terminating in a V-notch should be 0.003 in. (0.08 mm) or less. If a chevron form of notch is used, the root radius may be 0.010 in. (0.25 mm) or less. In the case of a slot tipped with a hole it will be necessary to provide a sharp stress raiser at the end of the hole. Care should be taken to ensure that this stress raiser is so located that the crack plane orientation requirements (8.2.4) can be met.

7.3.2 Fatigue Cracking—Fatigue cracking shall be conducted in accordance with the procedures outlined in Annex A2. Fatigue cycling shall be continued until the fatigue crack will satisfy the requirements stated in the following two sections.

7.3.2.1 The crack length (total length of the crack starter configuration *plus* the fatigue crack) shall be between 0.45 and 0.55 W.

7.3.2.2 For a straight-through crack starter terminating in a V-notch (see Fig. 7), the length of the fatigue crack on each surface of the specimen shall not be less than 2.5% of W or 0.050 in. (1.3 mm) min, and for a crack starter tipped with a

drilled hole (see Fig. 7), the fatigue crack extension from the stress raiser tipping the hole shall not be less than  $0.5\ D$  or 0.050 in. on both surfaces of the specimen, where D is the diameter of the hole (1.3 mm), min. For a chevron notch crack starter (see Fig. 7), the fatigue crack shall emerge from the chevron on both surfaces of the specimen.

#### 8. General Procedure

8.1 Number of Tests—It is recommended that at least three replicate tests be made for each material condition.

8.2 Specimen Measurement—Specimen dimensions shall conform to the tolerances shown in the appropriate annex. Three fundamental measurements are necessary for the calculation of  $K_{1c}$ , namely, the thickness, B, the crack length. a, and the width, W.

8.2.1 Measure the thickness, B, to the nearest 0.001 in (0.025 mm) or to 0.1 %, whichever is larger, at not less than three equally spaced positions along the line of intended crack extension from the fatigue crack tip to the unnotched side of the specimen. The average of these three measurements should be recorded as B.

8.2.2 Measure the crack length, a, after fracture to the nearest 0.5 % at the following three positions: at the center of the crack front, and midway between the center of the crack front, and the end of the crack front on each surface of the

specimen. Use the average of these three measurements as the crack length to calculate  $K_Q$ . The following requirements shall apply to the fatigue crack front: (1) The difference between any two of the three crack length measurements shall not exceed 10 % of the average. (2) For a chevron notch garter (see Fig. 7), the fatigue crack shall emerge from the chevron on both surfaces of the specimen, neither surface crack length shall differ from the average length by more than 10 %, and the difference between these two surface measurements shall not exceed 10 % of the average crack length. (3) For a straight-through starter notch (see Fig. 7) no part of the crack front shall be closer to the machined starter notch than 2.5 % W or 0.050 in. (1.3 mm) minimum, nor shall the surface crack length measurements differ from the werage crack length by more than 15 %, and the differences between these two measurements shall not exceed 10 % of the average crack length.

8.2.3 Measure the width, W, as described in the annex

appropriate to the specimen type being tested.

 $\frac{77}{8.2.4}$  The plane of the crack shall be parallel to both the specimen width and thickness direction within  $\pm 10^{\circ}$  (7).

18.3 Loading Rate—For conventional (static) testing load the specimen at a rate such that the rate of increase of stress intensity is within the range from 30 000 to 150 000 psi·in. 1/2/min (0.55 to 2.75 MPa·m<sup>1/2</sup>/s). The loading rates corresponding to these stress intensity rates are given in the appropriate annex for the specimen being tested. For rapid-bad testing the loading rates are given in Annex A7.

8.4 Test Record—Make a test record consisting of an autographic plot of the output of the load-sensing transducer versus the output of the displacement gage. The initial slope of the linear portion shall be between 0.7 and 1.5. It is conventional to plot the load along the vertical axis, as in an ordinary tension test record. Select a combination of load-sensing transducer and autographic recorder so that the load,  $P_Q$  (see 9.1), can be determined from the test record with an accuracy of  $\pm 1$  %. With any given equipment, the accuracy of readout will be greater the larger the scale of the test record.

8.4.1 Continue the test until the specimen can sustain no further increase in load. In some cases the range of the chart will not be sufficient to include all of the test record up to maximum load,  $P_{\rm max}$ . In any case, read the maximum load from the dial of the testing machine (or other accurate indicator) and record it on the chart.

### 9. Calculation and Interpretation of Results

the

hed

ITC-

rđ

ack

the

9.1 Interpretation of Test Record and Calculation of  $K_{1c}$ —In order to establish that a valid  $K_{1c}$  has been determined, it is necessary first to calculate a conditional result,  $K_Q$ , which involves a construction on the test record, and then to determine whether this result is consistent with the size and reld strength of the specimen according to 7.1. The procedure is as follows:

9.1.1 Draw the secant line  $OP_5$ , shown in Fig. 7 through the origin of the test record with slope  $(P/v)_5 = 0.95 (P/v)_o$ , where  $(P/v)_o$  is the slope of the tangent OA to the initial mear part of the record (Note 6). The load  $P_Q$  is then defined as follows: if the load at every point on the record such precedes  $P_5$  is lower than  $P_5$ , then  $P_5$  is  $P_Q$  (Fig. 8 Type in if, however, there is a maximum load preceding  $P_5$  which

exceeds it, then this maximum load is  $P_Q$  (Fig. 8 Types II and III).

Note 6—Slight nonlinearity often occurs at the very beginning of a record and should be ignored. However, it is important to establish the initial slope of the record with high precision and therefore it is advisable to minimize this nonlinearity by a preliminary loading and unloading with the maximum load not producing a stress intensity level exceeding that used in the final stage of fatigue cracking.

9.1.2 Calculate the ratio  $P_{\rm max}/P_Q$ , where  $P_{\rm max}$  is the maximum load the specimen was able to sustain (see 8.4). If this ratio does not exceed 1.10, proceed to calculate  $K_Q$  as described in the annex appropriate to the specimen being tested. If  $P_{\rm max}/P_Q$  does exceed 1.10, then the test is not a valid  $K_{\rm Ic}$  test because it is then possible that  $K_Q$  bears no relation to  $K_{\rm Ic}$ . In this case proceed to calculate the specimen strength ratio.

9.1.3 Calculate 2.5  $(K_Q/\sigma_{YS})^2$  where  $\sigma_{YS}$  is the 0.2 % offset yield strength in tension (see Test Methods E 8). If this quantity is less than both the specimen thickness and the crack length, then  $K_Q$  is equal to  $K_{Ic}$ . Otherwise, the test is not a valid  $K_{Ic}$  test. Expressions for calculations of  $K_Q$  are given in the annex appropriate to the specimen being tested.

9.1.4 If the test result fails to meet the requirements in 9.1.2 or in 9.1.3, or both, it will be necessary to use a larger specimen to determine  $K_{\rm LC}$ . The dimensions of the larger specimen can be estimated on the basis of  $K_Q$  but generally will be at least 1.5 times those of the specimen that failed to yield a valid  $K_{\rm LC}$  value.

9.1.5 Calculate the specimen-strength ratio  $R_{sx}$  according to the annex appropriate to the specimen being tested.

9.2 Fracture Appearance—The appearance of the fracture is valuable supplementary information and shall be noted for each specimen. Common types of fracture appearance are shown in Fig. 9. For fractures of Types (a) or (b), measure the average width, f, of the central flat fracture area, and note and record the proportion of oblique fracture per unit thickness (B-f)/B. Make this measurement at a location midway between the crack tip and the unnotched edge of the specimen. Report fractures of Type (c) as full oblique fractures.

# 10. Report

10.1 The specimen configuration code as shown with the specimen drawing in the appropriate annex shall be reported. In addition, this code shall be followed with loading code (T for tension and B for bending) and the code for crack plane orientation (see Section 5). These latter two codes should appear in separate parentheses. For example, a test result obtained using the compact specimen (see Annex A4) might be designated as follows: C(T)(S-T). The first letter indicates compact specimen. The second letter indicates the loading was tension and the first of the last two letters indicates that the normal to the crack plane is in the direction of principal deformation and the second of these letters indicates the intended direction of crack propagation is in the direction of least deformation.

10.2 In addition, the following information should be reported for each specimen tested.

10.2.1 The form of the product tested: for example, forging, plate, casting etc.

10.2.2 Thickness, B.

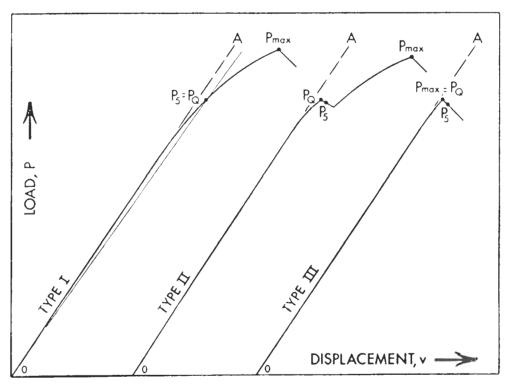


FIG. 8 Principal Types of Load-Displacement Records

- 10.2.3 Width (depth), W.
- 10.2.3.1 Offset of the loading holes, X, for the arc-shaped tension specimen.
- 10.2.3.2 Outer and inner radii,  $r_2$  and  $r_1$ , for arc-shaped specimens.
  - 10.2.4 Fatigue precracking conditions in terms of:
- 10.2.4.1 Maximum stress intensity, K(max), and number of cycles for terminal fatigue crack extension over a length at least 2.5 % of the overall length of notch plus crack, and
- 10.2.4.2 The stress intensity range for terminal crack extension.
  - 10.2.5 Crack length measurements:
  - 10.2.5.1 At center of crack front;
- 10.2.5.2 Midway between the center and the end of the crack front on each side; and at each surface.
  - 10.2.6 Test temperature.
- 10.2.7 Relative humidity as determined by Test Method E 337.
- 10.2.8 Loading rate in terms of  $K_1$  (change in stress intensity factor per unit time) (2).
- 10.2.9 Load-displacement record and associated calculations.
  - 10.2.10 Fracture appearance.
- 10.2.11 Yield strength (offset = 0.2%) as determined by Methods E 8.
- 10.2.12  $K_{Ic}$ ; or,  $K_Q$  followed by the parenthetical statement "invalid according to section(s).... of ASTM Test Method E 399."
- 10.2.13  $R_{xx}$  where x refers to the specimen configuration as given in the appropriate annex.
  - $10.2.14 \ P_{\text{max}}/P_{Q}$

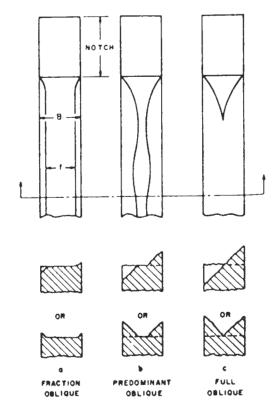


FIG. 9 Common Types of Fracture Appearance

10.3 It is desirable to list the information required in 101 and 10.2 in the form of a table. A suggested form for such table is given in Fig. 10.

STM			ATA SMEET		
MATERIAL/FORM		MEAT TREAT		,	
SPECIMEN 1.0.		SPECIMEN TYPE		*	5
و	DATE/	_/ <u>Mit</u>	. REPORT	\rightarrow\.	
PARTICULARS	DATA	REF. PARAGRAPH	FRACTURE TEST	DATA	REF. PARACRAPH
• Crack Piane Desentation	-	9.2	• Crack Lengths -		
. Material 0.2% Offset Tield		1 100	- At Center of Crack Froms (4,9)		8.2.2
Strength, Gye, per E8		2-4-1	- At Right of Center (ag)		8.2.2
• Thickness, B		8.2.1	- At Left of Center (ay)		0.2.2
• Depth (Width), W		8.2.2	- At Right of Surface (a4)		8:2.2
for - 58(8)		3.4-1 (Amex 3)	- At Left Surface (es)		1.1.1
for - G(T)		4.4.1 (Annex 4)	- Crack Plane Symmetry		1.2.4
for = DC(T)		6.4.1.2(Annax 6)	- Loading Rate (ksi - In./min.)		8,3
o has Shaped Specimen -			- Test Temperature		10.2.6
- Widoh, W		5.4.1 (Annex 5)	- Relative Mumidiky		40.2.7
- Mading Bule Offset, X		5.4.1 (Annex 5)	- Load-Displacement Record		8.4 6 9.2
- Guter and Immer Radia, r <sub>1</sub> 5 r <sub>2</sub>		5.4.1 (Amer 5)	7.3 V.SD.7 second consumer annual		
FATIGUE PRECRACKING	DATA	REF. PARAGRAPH	CALCULATION OF K & R.x	DATA	REF. PARACRAPH
• Kmax < 0.0d2in % (0.00032m % )		A2. 3. 1	• Pmax 'Pm = 1-1		9.1.2
● Knax 10-6 Kg		AT. T. I	- KQ SE(E)		3.5.3 (Annex 3)
• Kmag 40.8 Krs		AZ. 4.1 and AZ. 4.2	- Kg c(x)		4.5.3 (Annex +)
o it Temperature		1	- KD A(T)		5.5.7 (Annex 5)
- A KET Oya (TZ) - KO (TZ)		A2.4,4	- Kg DC(T)		6.5.3 (Atmex 6)
n Chack Lungth - Starter Stat plus Fatigue			- R <sub>SX</sub>		9.1.5
0.50		A2.3.7 and Figure &			
- Kara W					
Cycles for last 2.52					

FIG. 10 Suggested Form of Table for Reporting Information Listed in 10.1 and 10.2

# 11. Precision and Bias

11.1 Information on the precision of  $K_{Ic}$  measurements may be obtained from the results of several interlaboratory programs. Such programs, incorporating selected high strength alloys, have been reported for the bend specimen (8, 9), the compact specimen (9), and arc-shaped specimen (18). The results of these programs are summarized in this section. Interlaboratory programs of a more restrictive nature were also completed for beryllium and for dynamic plane strain fracture measurements on a strain rate sensitive steel. Summaries of the results from these two interlaboratory programs are presented in Annexes A7 and A8 because certain special procedures are involved. No interlaboratory program was conducted for the disk-shaped specimen, but some data comparing results from that specimen design with those from other specimen designs are given in Annex A6. It should be mentioned that not all of the results reported for the bend, compact and arc-shaped specimens met all the validity requirements. Statistical analysis (17, 18) was used to exclude data that were judged to be influenced by deviations from the validity requirements.

11.2 Precision—The precision of a  $K_{\rm Ic}$  determination depends in part on errors in the load and in the various required measurements of specimen dimensions including crack length. The method specifies a precision for each of these quantities and, based on this information coupled with the K determination, a theoretical precision has been developed (33). This analysis shows that precision decreases with increasing relative crack length and is somewhat higher for the compact than for the bend specimen. In actual practice, the precision of a  $K_{\rm Ic}$  measurement will depend to an

TABLE 1 Estimates of Precision for K<sub>ic</sub> Measurements for Three Specimen Types

	Specime	п Турев		
	$\sigma_{YS} = 353$ MPa (51.0 ksi)	$\sigma_{YS} = 1640$ MPa	18Ni Mar σ <sub>YS</sub> = 1902 MPa (276 ksi)	4340 σ <sub>ys</sub> = 1419 MPa (206 ksi)
		Bend Sp	pecimens	
Grand mean, XAB Standard deviation, SAB	. , , , , ,			86.7 (78.9) 3.67 (3.34)
	Compact Specimens			
Grand Mean, $\bar{X}^{A,B}$ Standard deviation, $S^{A,B}$	, ,	50.0 (45.5) 1.40 (1.27)		87.3 (79.4) 1.96 (1.78)
	Arc-tension specimens $4335V$ $\sigma_{YS} = 1320 \text{ MPa}$ $(192 \text{ ksi})$			
	X/W = 0   X/W = 0.5			= 0.5
Grand mean, XAB Standard deviation, SAB		(102.3) (3.50)		(101.7) (2.36)

A Units of grand mean and standard deviation are MPa m<sup>M</sup> (ksi in. M).

unknown extent on the characteristics and analysis of the test record. It is possible to derive useful information concerning the precision of a  $K_{Ic}$  measurement from the interlaboratory test programs. The results of these interlaboratory programs for the bend, compact and arc-shaped specimen are given in Table 1 for tests on several high strength alloys. These particular alloys were chosen because they are known to be producible with very uniform composition and micro-

<sup>&</sup>lt;sup>B</sup> The standard deviation has been pooled for all laboratories testing a given alloy. For data on which this Table was based, see Refs (8, 9) for the bend specimen, Ref (9) for the compact specimen, and Ref (18) for the arc-tension specimen.

structure. Thus the contribution of material variability to the measurements of  $K_{Ic}$  was minimized. It should be understood that the measures of precision listed in Table I apply to alloys which do not exhibit strong transitional fracture behavior with changes in temperature or strain rate. When temperature and strain rate variations induce large changes in toughness, increased scatter in  $K_{Ic}$  measurements may be noted. For example, within or below the transition range of a structural steel, the initial advance from the fatigue crack will

be controlled by the abrupt fracture of local elements at the crack tip, accompanied by rapid transfer of load to adjacent regions which may then exhibit cleavage fracture. Under these circumstances, a specimen size effect may be observed in which both the mean and the standard deviation of  $K_{\rm L}$  values tend to increase with decreasing specimen size.

11.3 Bias—There is no accepted "standard" value for the plane strain fracture toughness of any material. In the absence of such a true value, any statement concerning bias is not meaningful.


### **ANNEXES**

# (Mandatory Information)

#### A1. DESIGN FOR DOUBLE-CANTILEVER DISPLACEMENT GAGE

Al.1 The gage consists of two cantilever beams and a spacer block which are clamped together with a single nut and bolt, as shown in Fig. 4. Electrical-resistance strain gages are cemented to the tension and compression surfaces of each beam, and are connected as a Wheatstone bridge incorporating a suitable balancing resistor. The material for


the gage beams should have a high ratio of yield strength to elastic modulus, and titanium alloy 13V-11Cr-3Al in the solution treated condition has been found very satisfactor for this purpose. If a material of different modulus is substituted, the spring constant of the assembly will change correspondingly, but the other characteristics will not be

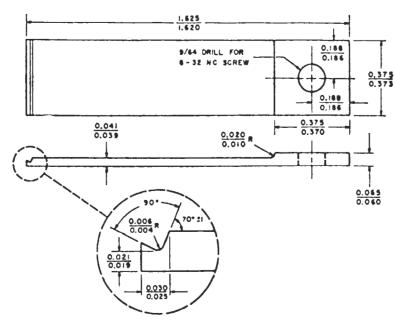

Note-Dimensions are in inches.

Metric Equivalents			
in.	mm	in.	mm
0.004	0.10	0.060	1.52
0.006	0.15	0.065	1.65
0.010	0.25	9/64	3.6
0.019	0.48	0.186	4.72
0.020	0.51	0.188	4.78
0.021	0.53	0.370	9.40
0.025	0.64	0.373	9.47
0.030	0.76	0.375	9.52
0.039	0.99	1.620	41.15
0.041	1.04	1.625	41.28

FIG. A1.1 Beams for Double-Cantilever Displacement Gage

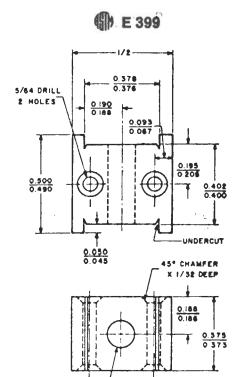

Note 1—5/64-in, diameter holes are for strain gage leads. Note 2—Dimensions are in inches.

9/64 DRILL FOR 6-32 NC SCREW

in.	mm	in.	mm
1/32	0.80	0.195	4.95
0.045	1.14	0.205	5.21
0.050	1.27	0.373	9.47
5/64	2.00	0.375	9.52
0.087	2.21	0.376	9.55
0.093	2.36	0.378	9.60
0.125	3.18	0.400	10.16
9/84	3.60	0.402	10.21
0.186	4.72	0.490	12.45
0.188	4.78	1/2	12.70
0.190	4.83	0.500	12.70

FIG. A1.2 Aluminum-Alloy Spacer Block for Double-Cantilever
Displacement Gage

affected. Detailed dimensions for the beams and spacer block are given in Figs. A1.1 and A1.2. For these particular dimensions the linear range (working range) is from 0.15 to 0.30 in. (3.8 to 7.6 mm) and the recommended gage length is from 0.20 to 0.25 in. (5.1 to 6.3 mm). The clip gage can be altered to adapt it to a different gage length by substituting a

spacer block of appropriate height. As discussed in 6.3.2 the required precision of the gage corresponds to a maximum deviation of  $\pm 0.0001$  in. (0.0025 mm) of the displacement readings from a least-squares-best-fit straight line through the data. Further details concerning design, construction and use of these gages are given in Ref (10).

# A2. FATIGUE PRECRACKING OF $K_{1c}$ FRACTURE TOUGHNESS SPECIMENS

### 12.1 Introduction

A2.1.1 Experience has shown that it is impractical to obtain a reproducibly sharp, narrow machined notch that will simulate a natural crack well enough to provide a satisfactory  $K_{1c}$  test result. The most effective artifice for this purpose is a narrow notch from which extends a comparatively short utigue crack, called the precrack. The dimensions of the notch and the precrack, and the sharpness of the precrack, must meet certain conditions which can be readily met with

most engineering materials since the fatigue cracking process can be closely controlled when careful attention is given to the known contributory factors. However, there are some materials that are too brittle to be fatigue cracked since they fracture as soon as the fatigue crack initiates; these are outside the scope of the present test method. The purpose of this annex is to provide guidance on the production of satisfactory fatigue precracks, and to state the associated requirements for a valid  $K_{1c}$  test.

A2.1.2 A fatigue precrack is produced by cyclically loading the notched specimen with a ratio of minimum to maximum stress between -1 and +0.1 for a number of cycles usually between about 10<sup>4</sup> and 10<sup>6</sup> depending on specimen size, notch preparation, and stress intensity level. The maximum stress intensity in the terminal (2.5 %) stage of fatigue crack growth must not exceed 60 % of the  $K_{1c}$  value of the material. Some fraction of the total number of cycles required to produce the fatigue precrack is consumed in initiation of the crack at the notch root; the remainder accounts for growth of the crack to the required length. If the total number of cycles is excessive, the reason is usually that the number of cycles required for initiation is excessive rather than that the subsequent rate of crack growth is low. There are several ways of promoting early crack initiation: (1) by providing a very sharp notch tip; (2) by using a chevron notch (Fig. 7); (3) by statically preloading the specimen in such a way that the notch tip is compressed in a direction normal to the intended crack plane but without allowing the nominal compressive stress to exceed the yield strength of the material; (4) by using a negative fatigue load ratio.

### A2.2 Equipment

A2.2.1 The equipment for fatigue cracking shall be such that the stress distribution is uniform through the specimen thickness; otherwise the crack will not grow uniformly. The stress distribution shall also be symmetrical about the plane of the prospective crack; otherwise the crack will deviate unduly from that plane and the test result will be significantly affected (7).

A2.2.2 The K calibration for the specimen, as loaded by the equipment, shall be known with an error of not more than 5 \%. The K calibration is the relation of the stress intensity factor K to either the load or to some prescribed displacement and the specimen dimensions (1). The fixtures recommended in the test method (see appropriate annex) are also suitable for fatigue cracking, and K calibrations for specimens loaded through these fixtures are given in the annexes of this test method. If different fixtures are used, the appropriate K calibration should be determined experimentally with these fixtures (7). The advantage of experimental Kcalibration, as compared with numerical methods of analysis, is that accurate modeling of the boundary conditions with the actual fixtures is assured. It is important to bear in mind that if the fatigue cycle involves reversal of load, the K calibration can be very sensitive to the distribution of clamping forces necessary to grip the specimen.

# **A2.3 Specimen Requirements**

A2.3.1 The fatigue precracking shall be conducted with the specimen fully heat treated to the condition in which it is to be tested.

A2.3.2 The combination of starter notch and fatigue precrack must conform to the requirements shown in Fig. 7. The nominal crack length is equal to  $0.50\,W$  and is the total length of the starter notch slot plus fatigue crack. To facilitate fatigue precracking at a low level of stress intensity, the notch root radius of a straight-across notch should be no more than 0.003 in. (0.08 mm). If a chevron notch is used (Fig. 7), the notch root radius can be as much as 0.01 in. (0.25 mm)

because of the compound stress intensification at the point of the chevron. Early crack initiation can also be promoted by precompression of the notch tip region, as stated in A2.1.2.

A2.3.3 It is advisable to mark two pencil lines on each side of the specimen normal to the anticipated paths of the surface traces of the fatigue crack. The line most distant from the notch tip should indicate the minimum required length of fatigue crack, and the other the terminal part of that length equal to not less than 2.5 % of the overall length of notch plus fatigue crack, that is 0.0125 W. During the final stage of fatigue crack extension, for at least this distance, the ratio of maximum stress intensity of the fatigue cycle to the Young's modulus of the material,  $K_{\rm max}/E$  shall not exceed 0.002in. 1/2 (0.00032 m<sup>1/2</sup>). Furthermore,  $K_{\rm max}$  must not exceed 60 % of the  $K_Q$  value determined in the subsequent test if  $K_Q$  is to qualify as a valid  $K_{1c}$  result.

ben

*tim*

con

equ

ben

are:

char

designation design

# **A2.4 Precracking Procedure**

A2.4.1 Fatigue precracking can be conducted under either load control or displacement control provided that the appropriate K calibration is known with requisite accuracy for the specimen and fixture (A2.2.1). If the load cycle is maintained constant, the maximum K and the K range will increase with crack length; if the displacement cycle is maintained constant, the reverse will happen. The initial value of the maximum fatigue load or displacement should be calculated from the K calibration and the specimen and notch dimensions. It is suggested that this load be selected so that the maximum stress intensity factor in the initial portion of the fatigue cycle does not exceed 80 % of the estimated  $K_{1c}$  value of the material. Higher K values may result in undesirably high crack growth rates. The minimum is then selected so that the stress ratio is between -1 and +0.1. The more negative the stress ratio, the faster the fatigue precrack will be completed, but this advantage is offset by the need for more elaborate fixtures than are required when the stress ratio is positive.

A2.4.2 The specimen shall be accurately located in the loading fixture and secured as required so that the boundary conditions correspond to the applicable K calibration. Fatigue cycling is then begun, usually with a sinusoidal waveform and near to the highest practical frequency. There is no known marked frequency effect on fatigue precrack formation up to at least 100 Hz in the absence of adverse environments. The specimen should be carefully monitored until crack initiation is observed on one side. If crack initiation is not observed on the other side before appreciable growth is observed on the first, then fatigue cycling should be stopped to try to determine the cause and remedy for the unsymmetrical behavior. Sometimes, simply turning the specimen around in relation to the fixture will solve the problem. When the most advanced crack trace has almost reached the first scribed line corresponding to 97.5 % of the final crack length, the maximum load or displacement, as appropriate, shall be reduced so that the terminal value of  $K_{\text{max}}$  is unlikely to exceed 60 % of the estimated minimum value of  $K_{1c}$  of the material, and also the terminal value of  $K_{\text{max}}/E$  will not exceed 0.002 in.<sup>1/2</sup> (0.00032 m<sup>1/2</sup>). The minimum setting is then adjusted so that the stress ratio is between -1 and +0.1. Fatigue cycling is then continued until the surface traces on both sides of the specimen indicate that

the overall length of notch plus crack will meet the requirements of 7.3.2.1, 7.3.2.2, and Fig. 7 of this test method.

A2.4.3 When fatigue cracking is conducted at a tempera-

ture  $T_1$  and testing at a different temperature  $T_2$ ,  $K_{\text{max}}$  must not exceed 0.6  $(\sigma_{\text{YS}_1}/\sigma_{\text{YS}_2})K_Q$ , where  $\sigma_{\text{YS}_1}$  and  $\sigma_{\text{YS}_2}$  are the yield strengths at the respective temperatures  $T_1$  and  $T_2$ .

# A3. SPECIAL REQUIREMENTS FOR THE TESTING OF BEND SPECIMENS

3.1 Specimen

A3.1.1 The standard bend specimen is a single edgenotched and fatigue cracked beam loaded in three-point bending with a support span, S, nominally equal to four times the width, W. The general proportions of this specimen configuration are shown in Fig. A3.1.

A3.1.2 Alternative specimens may have  $1 \le W/B \le 4$ . These specimens shall also have a nominal support span

equal to 4 W.

A3.2 Specimen Preparation

A3.2.1 For generally applicable specifications concerning specimen size and preparation see Section 7.

A3.2.2 It is desirable to fatigue crack the bend specimen in the same fixtures in which it will be tested so that the K calibration is accurately known. However, bend specimens are sometimes cracked in cantilever bending because this method permits ease of reversed loading. If the K calibration for three-point bending is used in cantilever bending, the bending moments for a given K value will be underestimated (7). While fatigue cracking in cantilever bending can yield satisfactory results, it should be emphasized that the crack tip stress field can be distorted and the fatigue crack orientation changed by excessive clamping forces.

A3.3 Apparatus

A3.3.1 Bend Test Fixture—The general principles of the bend test fixture are illustrated in Fig. A3.2. This fixture is designed to minimize frictional effects by allowing the support rollers to rotate and move apart slightly as the specimen is loaded, thus permitting rolling contact. Thus, the support rollers are allowed limited motion along plane surfaces parallel to the notched side of the specimen, but are nitially positively positioned against stops that set the span length and are held in place by low-tension springs (such as rubber bands).

A3.3.2 Displacement Gage—For generally applicable details concerning the displacement gage see 6.3. For the bend specimen the displacements will be essentially independent

of the gage length up to a gage length of W/2.

### A3.4 Procedure

A3.4.1 *Measurement*—For a bend specimen measure the width (depth), W, and the crack length, a, from the notched side of the specimen to the opposite side and to the crack front, respectively.

A3.4.1.1 For general requirements concerning specimen measurement see 8.2.

A3.4.2 Bend Specimen Testing—Set up the test fixture so that the line of action of the applied load shall pass midway between the support roll centers within 1 % of the distance between these centers (for example, within 0.04 in. (1.0 mm) for a 4-in. (100-mm) span). Measure the span to within 0.5 % of nominal length. Locate the specimen with the crack tip midway between the rolls to within 1 % of the span, and square to the roll axes within 2°. Seat the displacement gage on the knife edges to maintain registry between knife edges and gage grooves. In the case of attachable knife edges, seat the gage before the knife edge positioning screws are tightened.

A3.4.2.1 Load the specimen at a rate such that the rate of increase of stress intensity is within the range 30 to 150 ksi·in.  $^{1/2}$ /min (0.55 to 2.75 MPa·m<sup>1/2</sup>/s), corresponding to a loading rate for the standard (B = 0.5 W) 1-in. (25.4-mm) thick specimen between 4000 and 20 000 lbf/min (0.30 to 1.5 kN/s).

A3.4.3 For details concerning recording of the test record see 8.4.


#### A3.5 Calculations

A3.5.1 Interpretation of Test Record—For general requirements and procedures in interpretation of the test record see 9.1.

A3.5.2 Validity Requirements—For a description of the validity requirements in terms of limitations on  $P_{\rm max}/P_Q$  and the specimen size requirements, see 9.1.2 through 9.1.3.

A3.5.3 Calculation of  $K_Q$ —For the bend specimen calculate  $K_Q$  in units of ksi·in. (MPa·m<sup>1/2</sup>) as follows (Note A3.1):

 $K_Q = (P_Q S/BW^{3/2}) \cdot f(a/W)$ 

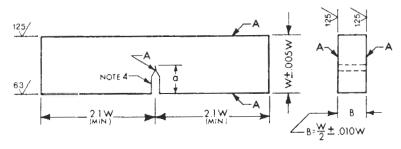


Note 1-A surfaces shall be perpendicular and parallel as applicable within 0.001 W TIR.

Note 2—Crack starter notch shall be perpendicular to specimen surfaces to within  $\pm 2^{\circ}$ .

NOTE 3-Integral or attachable knife edges for clip gage attachment may be used (see Figs. 5 and 6).

NOTE 4-For starter notch and fatigue crack configurations see Fig. 7.

FIG. A3.1 Bend Specimen SE (B)-Standard Proportions and Tolerances

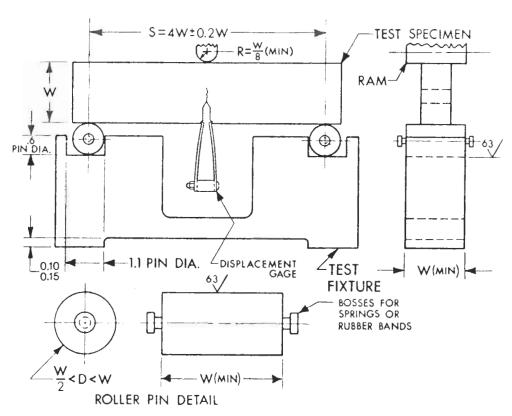

Note 1-Roller pins and specimen contact surface of loading ram must be parallel to each other within 0.002 W. NOTE 2-0.10 in, = 2.54 mm, 0.15 in. = 3.81 mm.

FIG. A3.2 Bend Test Fixture Design

where:

$$f(a/W) = \frac{3(a/W)^{1/2}[1.99 - (a/W)(1 - a/W)]}{\times (2.15 - 3.93a/W + 2.7a^2/W^2)]}$$

where:

 $P_Q$  = load as determined in 9.1.1, klbf (kN),

 $B^{-}$  = specimen thickness as determined in 8.2.1, in. (cm),

S = span as determined in A3.4.2, in. (cm),

W = specimen depth (width) as determined in A3.4.1, in. (cm), and

= crack length as determined in 8.2.2, in. (cm).

NOTE A3.1—This expression is considered to be accurate within  $\pm 0.5$  % over the entire range of a/W from 0 to 1 for an S/W = 4 (12).

To facilitate calculation of  $K_{O}$ , values of f(a/W) are tabulated in the following table for specific values of a/W.

Bend Specimens

a/W	f(a/W)	a/W	f(a/W)
0.450	2.29	0.500	2.66
0.455	2.32	0.505	2.70
0.460	2.35	0.510	2.75
0.465	2.39	0.515	2.79
0.470	2,43	0.520	2.84
0.475	2.46	0.525	2.89
0.480	2.50	0.530	2.94
0.485	2.54	0.535	2.99
0.490	2.58	0.540	3.04
0.495	2.62	0.545	3.09
		0.550	3.14

A3.5.4 Calculation of  $R_{sb}$ —For the bend specimen calculate the specimen strength ratio (which is dimensionless and has the same value in any consistent system of units):

$$R_{sb} = \frac{6P_{\text{max}}W}{B(W-a)^2\sigma_{\text{YS}}}$$

where:

 $P_{\text{max}} = \text{maximum load that the specimen was able to sustain.}$ 

B = thickness of specimen as determined in 8.2.1,

= width (depth) of specimen, as determined in A3.4.1.

= crack length as determined in 8.2.2, and

 $\sigma_{YS}$  = yield strength in tension (offset = 0.2 %) (see Test Methods E 8).

A3.5.5 Calculation of Crack Mouth Opening Compliance Using Crack Length Measurements-For bend specimens calculate the crack mouth opening compliance,  $V_m/P$ . <sup>10</sup> units of m/N (in./lb) as follows (see Note A3.2):

$$V_m/P = (S/E'BW) \cdot q(a/W)$$

where:

$$q(a/W) = 6(a/W)[0.76 - 2.28(a/W) + 3.87(a/W)^2 - 2.04(a/W)^3 + 0.66/(1 - a/W)^2].$$
 and

where:

 $V_m$  = crack mouth opening displacement, m (in.), P = applied load, kN (klbf),

E' = Effective Young's Modulus (= E for plane stress,  $\rho_3$ (psi); = E/(1 -  $\nu^2$ ) for plane strain, Pa (psi)),

= Poisson's Ratio, and

S, B, W, and a are as defined in A3.5.3.

Note A3.2—This expression is considered to be accurate to within  $\pm 1.0$  % for any a/W (23). This expression is valid only for crack mouth displacements measured at the location of the integral knife edges shown in Fig. 5. If attachable knife edges are used, they must be reversed or inset to provide the same measurement point location.

A3.5.5.1 To facilitate the calculation of crack mouth opening compliances, values of q(a/W) are given in the following table for specific values of a/W:

a/W	q(a/W)	a/W	q(a/W)
0.450	6.79	0.500	8.92
0.455	6.97	0.505	9.17
0.460	7.16	0.510	9.43
0.465	7.36	0.515	9.70
0.470	7.56	0.520	9.98
0.475	7.77	0.525	10.27
0.480	7.98	0.530	10,57
0.485	8.21	0.535	10.88
0.490	8.44	0.540	11.19
0.495	8.67	0.545	11.53
		0.550	11.87

A3.5.6 Calculation of Crack Lengths Using Crack Mouth Opening Compliance Measurements—For bend specimens, calculate the normalized crack length as follows (see Note A3.3):

$$a/W = 0.9997 - 3.95U + 2.982U^2 - 3.214U^3$$

 $+51.52U^4 - 113.0U^5$ 

where:

$$U = 1/\{1 + [(E'BV_{\rm m}/P)(4W/S)]^{1/2}\}$$

Note A3.3—This expression fits the equation in A3.5.5 within  $\pm 0.01$  % of W for  $0.3 \le a/W \le 0.9$  (24). This expression is valid only for crack mouth displacements measured at the location of the integral knife edges shown in Fig. 5. If attachable knife edges are used, they must be reversed or inset to provide the same measurement point location.

# A4. SPECIAL REQUIREMENTS FOR THE TESTING OF COMPACT SPECIMENS

# A4.1 Specimen

A4.1.1 The standard compact specimen is a single edgenotched and fatigue cracked plate loaded in tension. The general proportions of this specimen configuration are shown in Fig. A4.1.


A4.1.2 Alternative specimens may have  $2 \le W/B \le 4$  but with no change in other proportions.

# A4.2 Specimen Preparation

A4.2.1 For generally applicable specifications concerning specimen size and preparation see Section 7.

# A4.3 Apparatus

A4.3.1 Tension Testing Clevis—A loading clevis suitable for testing compact specimens is shown in Fig. A4.2. Both ends of the specimen are held in such a clevis and loaded

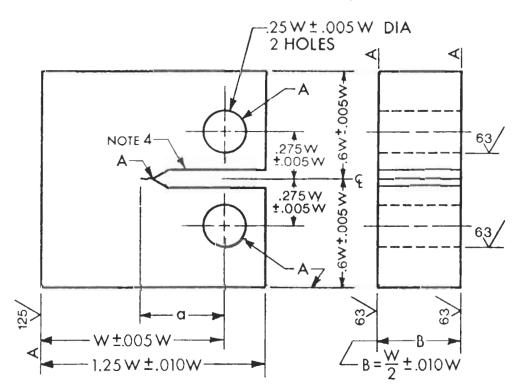


NOTE 1-A surfaces shall be perpendicular and parallel as applicable to within 0.002 W TIR.

FIG. A4.1 Compact Specimen C (T) Standard Proportions and Tolerances

Note 2—The intersection of the crack starter notch tips with the two specimen surfaces shall be equally distant from the top and bottom edges of the specimen within 105 w

YOTE 3-Integral or attachable knife edges for clip gage attachment to the crack mouth may be used (see Fig. 5 and 6).

NOTE 4-For starter notch and fatigue crack configuration see Fig. 7.

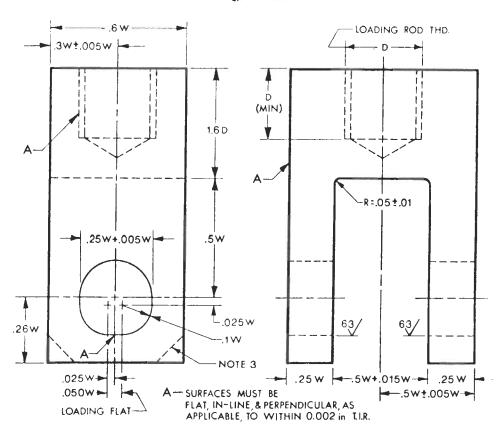

Note 1—Pin diameter = 0.24 W (+0.000 W/-0.005 W). For specimens with  $\sigma_{YS} > 200$  ksi (1379 MPa) the holes in the specimen and in the clevis may be 0.3 W (+0.005 W/-0.000 W) and the pin diameter 0.288 W (+0.000 W/-0.005 W).

NOTE 2-0.002 in. = 0.051 mm.

Note 3-Corners of the clevis may be removed if necessary to accommodate the clip gage.

FIG. A4.2 Tension Testing Clevis Design

through pins, in order to allow rotation of the specimen during testing. In order to provide rolling contact between the loading pins and the clevis holes, these holes are provided with small flats on the loading surfaces (4). Other clevis designs may be used if it can be demonstrated that they will accomplish the same result as the design shown.

A4.3.1.1 The critical tolerances and suggested proportions of the clevis and pins are given in Fig. A4.2. These proportions are based on specimens having W/B = 2 for B > 0.5 in. (12.7 mm) and W/B = 4 for  $B \le 0.5$  in. (12.7 mm). If a 280 000-psi (1930-MPa) yield strength maraging steel is used for the clevis and pins, adequate strength will be obtained for testing the specimen sizes and  $\sigma_{YS}/E$  ratios given in 7.1.3. If lower-strength grip material is used, or if substantially larger specimens are required at a given  $\sigma_{YS}/E$  ratio than those shown in 7.1.3, then heavier grips will be required. As indicated in Fig. A4.2 the clevis corners may be cut off sufficiently to accommodate seating of the clip gage in specimens less than 0.375 in. (9.5 mm) thick.

A4.3.1.2 Careful attention should be given to achieving as good alignment as possible through careful machining of all auxiliary gripping fixtures.

A4.3.2 Displacement Gage—For generally applicable details concerning the displacement gage see 6.3. For the compact specimen the displacements will be essentially independent of the gage length up to 1.2 W.

# A4.4 Procedure

A4.4.1 Measurement—For a compact specimen measure the width, W, and the crack length, a, from the plane of the centerline of the loading holes (the notched edge is a convenient reference line but the distance from the centerline of the holes to the notched edge must be subtracted to determine W and a). Measure the width, W, to the nearest 0.001 in. (0.025 mm) or 0.1 %, whichever is larger, at not less than three positions near the notch location, and record the average value.

fol

±0

A4.4.1.1 For general requirements concerning specimen measurement see 8.2.

A4.4.2 Compact Specimen Testing—When assembling the loading train (clevises and their attachments to the tensile machine) care should be taken to minimize eccentricity of loading due to misalignments external to the clevises. To obtain satisfactory alignment keep the centerline of the upper and lower loading rods coincident within 0.03 in (0.76 mm) during the test and center the specimen with respect to the clevis opening within 0.03 in. (0.76 mm).

A4.4.2.1 Load the compact specimen at such a rate that the rate of increase of stress intensity is within the range 30 to 150 ksi·in. 1/2/min (0.55 to 2.75 MPa·m<sup>1/2</sup>/s) corresponding to a loading rate for a standard (W/B = 2) 1-in. thick specimen between 4500 and 22 500 lbf/min (0.34 to 1.7 kN/s).

A4.4.2.2 For details concerning recording of the test mord, see 8.4.

# 45 Calculations

A4.5.1 For general requirements and procedures in interration of the test record see 9.1.

A4.5.2 For a description of the validity requirements in of limitations on  $P_{\text{max}}/P_Q$  and the specimen size quirements see 9.1.2 through 9.1.3.

A4.5.3 Calculation of  $K_Q$ —For the compact specimen scalate  $K_Q$  in units of ksi·in.<sup>1/2</sup> (MPa·m<sup>1/2</sup>) from the coloring expression (Note A4.1)

$$K_Q = (P_Q/BW^{1/2}) \cdot f(a/W)$$

obere:

$$f(a/W) = \frac{(2 + a/W)(0.886 + 4.64a/W)}{(1 - a/W)^{3/2}}$$

, = load as determined in 9.1.1, klbf (kN),

g' = specimen thickness as determined in 8.2.1, in. (cm),

= specimen width, as determined in A4.4.1, in. (cm), and

= crack length as determined in 8.2.2 and A4.4.1, in. (cm).

NOTE A4.1-This expression is considered to be accurate within 20.5% over the range of a/W from 0.2 to 1 (12) (13).

A4.5.3.1 To facilitate calculation of  $K_O$ , values of f(a/W)are tabulated below for specific values of a/W.

Compact Specimens					
a/W	f(a/W)	a/W	f(a/W)		
0.450	8.34	0.500	9.66		
0.455	8.46	0.505	9.81		
0.460	8.58	0.510	9.96		
0.465	8.70	0.515	10.12		
0.470	8.83	0.520	10.29		
0.475	8.96	0.525	10.45		
0.480	9.09	0.530	10.63		
0.485	9.23	0.535	10.80		
0.490	9.37	0.540	10.98		
0.495	9.51	0.545	11.17		
		0.550	11.36		

A4.5.4 Calculation of  $R_{sc}$ —For the compact specimen alculate the specimen strength ratio (which is dimensionless and has the same value in any consistent system of units):

$$R_{sc} = \frac{2P_{\text{max}}(2W + a)}{B(W - a)^2 \sigma_{\text{VS}}}$$

 $rac{2}{2}_{max}$  = maximum load that the specimen was able to sustain,  $\theta$  = thickness of specimen as determined in 8.2.1,

+ = width of the specimen as determined in A4.4.1,

= crack length as determined in 8.2.2 and A4.4.1, and  $\sigma_{\rm YS}$  = yield strength in tension (offset = 0.2 %) (see Test Methods E 8).

TAX THREE !

A4.5.5 Calculation of Crack Mouth Opening Compliance Using Crack Length Measurements—For compact specimens, calculate the crack mouth opening compliance,  $V_m/P$ , in units of m/N (in./lb) as follows (see Note A4.2):

$$V_m/P = (1/E'B) \cdot q(a/W)$$

where:

$$q(a/W) = [19.75/(1 - a/W)^2] [0.5 + 0.192(a/W) + 1.385(a/W)^2 - 2.919(a/W)^3 + 1.842(a/W)^4],$$
and

where:

 $V_m = \text{crack mouth opening displacement, m (in.),}$ 

P = applied load, kN (klbf),

E' = Effective Young's Modulus (= E for plane stress, Pa (psi); = E/(1 -  $\nu^2$ ) for plane strain, Pa (psi)),

= Poisson's Ratio, and

B, W, and a are as defined in A4.5.3.

NOTE A4.2—This expression is considered to be accurate to within  $\pm 1.0 \%$  for any  $a/W \ge 0.2$  (25). This expression is valid only for crack mouth displacements measured at the location of the integral knife edges shown in Fig. 5. If attachable knife edges are used, they must be reversed or inset to provide the same measurement point location.

A4.5.5.1 To facilitate the calculation of crack mouth opening compliances, values of q(a/W) are given in the following table for specific values of a/W:

	a/W	q(a/W)	a/W	q(a/W)
	0.450	44.16	0.500	54.71
	0.455	45.09	0.505	55.94
	0.460	46.04	0.510	57.22
	0.465	47.02	0.515	58.53
	0.470	48.02	0.520	59.88
	0.475	49.06	0.525	61.28
	0.480	50.12	0.530	62.73
	0.485	51.22	0.535	64.22
	0.490	52.35	0.540	65.76
	0.495	53.51	0.545	67.35
			0.550	69.00
_	~			~

A4.5.6 Calculation of Crack Lengths Using Crack Mouth Opening Compliance Measurements-For compact specimens, calculate the normalized crack length as follows (see Note A4.3):

$$a/W = 1.000 - 4.500U + 13.157U^2 - 172.551U^3 + 879.944U^4 - 1514.671U^5$$

where:


$$U = 1/[1 + (E'BV_m/P)^{1/2}]$$

NOTE A4.3—This expression fits the equation in A4.5.5 within  $\pm 0.01$  % of W for  $0.2 \le a/W \le 0.8$  (25). This expression is valid only for crack mouth displacements measured at the location of the integral knife edges shown in Fig. 5. If attachable knife edges are used, they must be reversed or inset to provide the same measurement point location.

# A5. SPECIAL REQUIREMENTS FOR THE TESTING OF THE ARC-SHAPED TENSION SPECIMEN

# **15.1** Specimen

45.1.1 The arc-shaped tension specimen is a single edgetotched and fatigue cracked ring segment loaded in tension. ic general proportions of two designs of the specimen are which in Fig. A5.1. The value of the radius ratio  $r_1/r_2$  is not excisied, so that specimens can be taken from any cylindrical geometery. However, it should be noted that specimens with  $r_1/r_2 = 0$  (that is, from a solid cylinder) do not make the best possible use of the test material because the definition of W was chosen to accommodate hollow cylinders. The disk-shaped specimen should be used for tests on solid cylinders (see Annex A6).

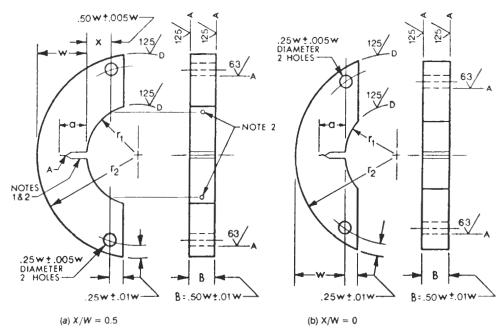

Note 1-For starter notch and fatigue crack configurations see Fig. 7.

Note 2-Alternative displacement gage reference points (see A5.4.1.1 for calculation of (a)).

Note 3-Axis of holes to be tangent to inner radius within 0.005W

Note 4—A surfaces to be perpendicular and parallel as applicable to within 0.002 W TIR. D surfaces to be perpendicular or parallel as applicable to A surfaces to within 0.002 W TIR (see A5.4.1).

FIG. A5.1 Arc-Shaped Specimen Designs A (T) Standard Proportions and Tolerances

A5.1.2 The arc-shaped tension specimen is intended to measure the fracture toughness so that the normal to the crack plane is in the circumferential direction and the direction of crack propagation is in the radial direction. This is the *C-R* orientation as defined in 5.1.3. For other orientations, a bend (Annex A3) or a compact (Annex A4) specimen should be used.

A5.1.3 The specimen with X/W = 0.5 (Fig. A5.1a) represents a half ring segment. The specimen with X/W = 0 (Fig. A5.1b) represents the smallest specimen of this configuration that can be cut from a ring.

A5.1.4 Alternative specimens may have  $2 \le W/B \le 4$  but with no change in other proportions. The use of alternative specimen proportions can be advantageous because in many cases it is possible to test ring segments with no machining of the inner and outer radii, that is, with no change in W.

#### **A5.2 Specimen Preparation**

A5.2.1 For generally applicable specifications concerning specimen size and preparation see Section 7.

### A5.3 Apparatus

A5.3.1 Tension Testing Clevis—A loading clevis suitable for testing arc-shaped tension specimens is shown in Fig. A5.2. Both ends of the specimen are held in such a clevis and loaded through pins, in order to allow rotation of the specimen during testing. In order to provide rolling contact between the loading pins and the clevis holes, these holes are provided with small flats on the loading surface (4). Other clevis designs may be used if it can be demonstrated that they will accomplish the same result as the design shown.

A5.3.1.1 The critical tolerances and suggested proportions

of the clevis and pins are given in A5.2. These proportions are based on specimens having W/B=2 for B>0.5 in. (12.7 mm) and W/B=4 for  $B\le 0.5$  in. (12.7 mm). If a 280 000-psi (1930-MPa) yield strength maraging steel is used for the clevis and pins, adequate strength will be obtained for testing the specimen sizes and  $\sigma_{YS}/E$  ratios given in 7.1.3. If lower-strength grip material is used, or is substantially larger specimens are required at a given  $\sigma_{YS}/E$  ratio than those shown in 7.1.3, then heavier grips will be required. As indicated in Fig. A5.2, the clevis corners may be cut off sufficiently to accommodate seating of the clip gage in specimens less than 0.375 in. (9.5 mm) thick.

A5.3.1.2 Careful attention should be given to achieving a good alignment as possible through careful machining of all auxiliary gripping fixtures.


A5.3.2 Displacement Gage—For generally applicable de tails concerning the displacement gage see 6.3.

A5.3.2.1 An alternative means of measuring the displacement is allowed for the specimen with X/W = 0.5. Conical center-punch-type indentations are provided on the inner surface of the specimen at mid-thickness and in the plane of the center line of the loading holes as shown in Fig. A5.18. The load-point displacement of the specimen is measured at these points using a displacement gage fitted with points and meeting the requirements described in 6.4.1.

A5.3.2.2 The displacements will be essentially independent of the gage length for the arc-shaped specimen provided the gage length is equal to or less than W/2.

### A5.4 Procedure

A5.4.1 Measurement—Before testing an arc-shaped specimen, measure  $(r_1 - r_2)$  to the nearest 0.001 in. (0.025 mm)

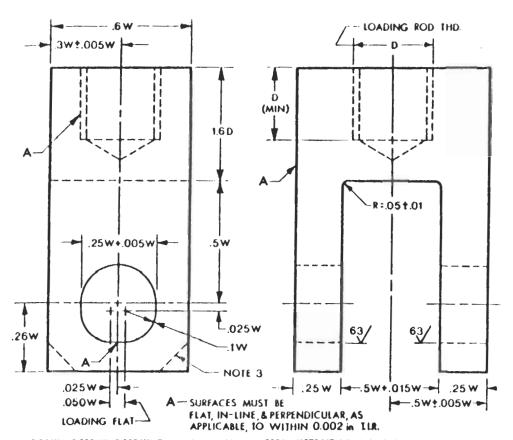

 $_{WCTE}$  1—Pin diameter = 0.24 W (+0.000 W/-0.005 W). For specimens with  $\sigma_{YS}$  > 200 ksi (1379 MPa) the holes in the specimen and in the clevis may be 0.3 W (+0.005 W) and the pin diameter 0.288 W (+0.000 W/-0.005 W).

₩ 7£ 2--0.002 in. = 0.051 mm.

NOTE 3-Corners of the clevis may be removed if necessary to accommodate the clip gage.


FIG. A5.2 Tension Testing Clevis Design

\* to 0.1 %, whichever is greater at mid-thickness positions no both sides of and immediately adjacent to the crack garter notch mouth. Record the average of these two addings as W. Also measure  $(r_1 - r_2)$  at four positions, two is close as possible to the loading holes and two at approxinately one-half the circumferential distance between the bading holes and the crack plane. If any of these four neasurements differ from W by more than 10 %, the specimen should be discarded or reworked. Next, measure to the nearest 0.001 in. (0.025 mm) or to 0.1 %, whichever is greater, the distance between the loading hole centers and the outside surface of the specimen at the notch plane. This neasurement should be made on both sides of the specimen referencing the loading holes. Subtract W from the werage of these two measurements and record the result as 7. Measure within 5 % the outer radius,  $r_2$ ; if this is not possible, determine the average value of  $r_2$  as follows (see Note A5.1): Measure within 5 % the length, L, of the chord if the outer surface, which chord passes through the loading while centers (see Fig. A5.3). Using this measurement, calcu-

$$r_2 = \frac{L^2}{8(W+X)} + \frac{(W+X)}{2}$$

Then  $r_1/r_2 = 1 - W/r_2$ .

NOTE A5.1—A 10 % variation of the ratio  $r_1/r_2$  will affect the value  $\sharp$  the stress intensity factor by 1 % or less, providing that the relative

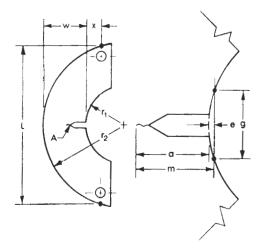

116 00

FIG. A5.3 Measurement of Outer Radius (r<sub>2</sub>) and Crack Length for the Arc-Shaped Specimen (see A5.4.1)

crack length a/W is not less than 0.3. However, the stress analysis is based on the assumption that the specimens are to be cut from stock of uniform, axisymmetric cross section. If inspection shows that the stock deviates from axisymmetry by more than 10 %, it should be reworked to within this tolerance.

A5.4.1.1 After fracture, measure the crack length in

accordance with 8.2.2, but a special procedure is necessary for the arc-shaped tension specimen due to its curvature. Thus, a length measurement, m, made from a reference point adjacent to the crack mouth to a point on the crack front will be greater than the corresponding distance from the virtual point of intersection between the crack plane and the inside circumference of the specimen (see Fig. A5.3). The error, e, may be computed from the following expression:

$$e = r_1 - \left[r_1^2 - \frac{g^2}{4}\right]^{1/2}$$

where g is the distance across the crack mouth at the reference points for measurement of the crack length. It should be noted that g may be equal to N (Fig. 7) or larger than N if machined knife edges are used to hold the clip gage (for example, g = 0.25 in. (6.4 mm) as in Fig. 5). If the relative error e/m < 0.01, then record m as the crack length; otherwise e should be subtracted from m and the result recorded as the crack length.

A5.4.2 Arc-Shaped Tension Specimen Testing—When assembling the loading train (clevises and their attachments to the tension machine) care should be taken to minimize eccentricity of loading due to misalignments external to the clevises. To obtain satisfactory alignment keep the centerline of the upper and lower loading rods coincident within 0.03 in. (0.76 mm) during the test and center the specimen with respect to the clevis opening within 0.03 in. (0.76 mm).

A5.4.2.1 Load the arc-shaped specimen at such a rate that the rate of increase of stress intensity is within the range 30 to 150 ksi·in.  $^{1/2}$ /min (0.55 to 2.75 MPa·m $^{1/2}$ /s). The corresponding loading rates for a standard (W/B = 2) 1-in. thick specimen are: (1) for the specimen with an X/W = 0.5between 2800 and 14 000 lbf/min (0.2 to 1.0 kN/s) and (2) for the specimen with an X/W = 0 between 4500 and 22 500 lbf/min (0.34 to 1.7 KN/s).

A5.4.2.2 For details concerning recording of the test record see 8.4.

### A5.5 Calculations

A5.5.1 For general requirements and procedures in interpretation of the test record see 9.1.

A5.5.2 For a description of the validity requirements in terms of limitations on  $P_{\text{max}}/P_Q$  and the specimen size requirements see 9.1.2 through 9.1.3.

A5.5.3 Calculation of  $K_Q$ —For the arc-shaped specimen calculate  $K_Q$  in units of ksi·in.<sup>1/2</sup> (MPa·m<sup>1/2</sup>) from the following expression (Note A5.2):

$$\begin{split} K_Q &= (P_Q/BW^{1/2})[3X/W + 1.9 + 1.1a/W] \\ &\times [1 + 0.25(1 - a/W)^2(1 - r_1/r_2)]f(a/W) \end{split}$$

$$f(a/W) = [(a/W)^{1/2}/(1 - a/W)^{3/2}] \times [3.74 - 6.30a/W + 6.32(a/W)^2 - 2.43(a/W)^3]$$

where:

 $P_{Q}$ = load as determined in 9.1.1, klbf (kN),

= specimen thickness as determined in 8.2.1, in. (cm),

X = loading hole offset as determined in A5.4.1, in. (cm),

W= specimen width as determined in A5.4.1, in. (cm),

= crack length as determined in 8.2.2 and A5.4.1.1, in. (cm), and

 $r_1/r_2$  = ratio of inner to outer radii as determined in A5.4.1.

Note A5.2—The accuracy of this expression for all values of  $r_1/r_{c,B}$ considered to be as follows: (1)  $\pm 1$  % for  $0.45 \le a/W \le 0.55$  and X/W0 or 0.5, (2)  $\pm 1.5$  % for  $0.2 \le a/W \le 1$  and X/W of 0 or 0.5, and U $\pm 3\%$  for  $0.2 \le a/W \le 1$  and  $0 \le X/W \le 1$  (14).

A5.5.3.1 To facilitate calculation of  $K_O$ , values of f(a/3)are tabulated in the following table for specific values of a/W:

a/W	f(a/W)	a/W	f(a/W)
0.450	3.23	0.500	3.73
0.455	3.27	0.505	3.79
0.460	3.32	0.510	3.85
0.465	3.37	0.515	3.91
0.470	3.42	0.520	3.97
0.475	3.47	0.525	4.03
0.480	3.52	0.530	4.10
0.485	3.57	0.535	4.17
0.490	3.62	0.540	4.24
0.495	3.68	0.545	4.31
		0.550	4.38

A5.5.4 Calculation of  $R_{sa}$ —For the arc-shaped tension specimen calculate the specimen strength ratio (which is dimensionless and has the same value in any consistent system of units) as follows:

$$R_{sa} = \frac{2P_{\max}(3X + 2W + a)}{B(W - a)^2 \sigma_{YS}}$$

where:

 $P_{\text{max}} = \text{maximum load that the specimen was able to sustain.}$ 

= thickness of the specimen as determined in 8.2.1,

X = loading hole offset as determined in A5.4.1, = width of the specimen as determined in A5.4.1,

= crack length as determined in 8.2.2 and A5.4.1.1, and

 $\sigma_{YS}$  = yield strength in tension (offset = 0.2 %) (see Methods E 8).

A5.5.5 Calculation of Crack Mouth Opening Compliance Using Crack Length Measurements—For arc-shaped tension specimens, calculate the crack mouth opening compliance.  $V_m/P$ , in units of m/N (in./lb) as follows (see Note A5.3): for the specimen with X/W = 0:

$$V_m/P = [p_1(a/W)/E'B] \cdot [0.43(1 - r_1/r_2) + q_1(a/W)]$$

where:

$$p_1(a/W) = (1 + a/W)/(1 - a/W)^2$$

$$q_1(a/W) = 0.542 + 13.137(a/W) - 12.316(a/W)^2 + 6.576(a/W)^3$$

or, for the specimen with X/W = 0.5,

$$V_m/P = [p_2(a/W)/E'B] \cdot [0.45(1 - r_1/r_2) + q_2(a/W)]$$

where:

$$p_2(a/W) = (2 + a/W)/(1 - a/W)^2$$
  
 $q_2(a/W) = 0.399 + 12.63(a/W) - 9.838(a/W)^2 + 4.66(a/W)^3$ , and

 $V_m$  = crack mouth opening displacement, m (in.), P = applied load, kN (klbf),

E' = Effective Young's Modulus (= E for plane stress, P)(psi); =  $E/(1 - \nu^2)$  for plane strain, Pa (psi),

= Poisson's Ratio, and

X, B, W, a, and  $(r_1/r_2)$  are as defined in A5.5.3.

Note A5.3—These expressions are considered to be accurate within  $\pm 1.4\%$  (X/W = 0) or  $\pm 1.6\%$  (X/W = 0.5) for  $0.2 \le a/W \le 0.5$ and  $(r_1/r_2) \ge 0.4$  (25). These expressions are valid only for crack model displacement. displacements measured at the location of the integral knife comparable to that shown in Fig. 5. If attachable knife edges are used

must be reversed or inset to provide the same measurement point

A5.5.5.1 To facilitate the calculation of crack mouth open-compliances, values of  $p_1(a/W)$ ,  $p_2(a/W)$ ,  $q_1(a/W)$ , and are given in the following table for specific values of

a/W	$p_1(a/W)$	$q_1(a/W)$	$p_2(a/W)$	$q_2(a/W)$
0.450	4.79	4.56	8.10	4.51
0.455	4.90	4.59	8.27	4.55
0.460	5.01	4.62	8.44	4.58
0.465	5.12	4.65	8.61	4.61
0.470	5.23	4.68	8.79	4.65
0.475	5.35	4.71	8.98	4.68
0.480	5.47	4.74	9.17	4.71
0.485	5.60	4.77	9.37	4.74
0.490	5.73	4.80	9.57	4.77
0.495	5.86	4.82	9.78	4.81
0.500	6.00	4.85	10.00	4.84
0.505	6.14	4.88	10.22	4.87
0.510	6.29	4.91	10.45	4.90
0.515	6.44	4.94	10.69	4.93
0.520	6.60	4.97	10.94	4.96
0.525	6.76	5.00	11.19	4.99
0.530	6.93	5.02	11.45	5.02
0.535	7.10	5.05	11.72	5.05
0.540	7.28	5.08	12.00	5.08
0.545	7.46	5.11	12.29	5.11
0.550	7.65	5.14	12.59	5.14

A5.5.6 Calculation of Crack Lengths Using Crack Mouth Opening Compliance Measurements—For arc-shaped specimens, calculate the normalized crack length as follows (see Note A5.4):

for the specimen with X/W = 0:

$$a/W = 0.989 - 3.463U - 0.171U^2$$

$$+24.354U^3 - 72.805U^4 + 84.375U^5$$

where:

$$U = 1/\{1 + [(E'BV_m/P)(1 + 0.101(1 - r_1/r_2))]^{V_2}\}$$
  
or, for the specimen with  $X/W = 0.5$ :

$$a/W = 0.986 - 4.082U - 5.0650U^2$$

$$+86.819U^3 - 313.338U^4 + 429.101U^5$$

where:

$$U = 1/\{1 + [(E'BV_m/P)(1 + 0.108(1 - r_1/r_2))]^{1/2}\}$$

NOTE A5.4—This expression fits the equations in A5.5.5 within  $\pm 0.003 \, W$  for  $0.2 \le a/W \le 0.8$ ,  $(r_1/r_2) \ge 0.4$ , and X/W = 0 or X/W = 0.5 (25). This expression is valid only for crack mouth displacements measured at the location of the integral knife edges comparable to that shown in Fig. 5. If attachable knife edges are used, they must be reversed or inset to provide the same measurement point location.

# A6. SPECIAL REQUIREMENTS FOR THE TESTING OF THE DISK-SHAPED COMPACT SPECIMEN

# 16.1 Specimen

alues of

.55 and

or 0.39

es of the

fair

4.17. 4.24

431

4.38

aped te

io (which

ly consider

in 8.2.1,

A5.4.1,1

see Metho

Complian

compliance

aped tend

ote A5.3

(a/M)

ne stress, A

e accurate to

 $2 \leq a/W \leq 2$ 

ir crack mos

al knife

edges are

si),

fic value

16.1.1 The standard disk-shaped compact specimen is a angle edge-notched and fatigue cracked disk segment loaded a tension (16). The general proportions of this specimen configuration are shown in Fig. A6.1.

46.1.2 Alternative specimens may have 2 < W/B < 4 but 11th no change in other proportions.

# 16.2 Specimen Preparation

A6.2.1 For generally applicable specifications concerning recimen size and preparation see Section 7.

### 16.3 Apparatus

A6.3.1 Tension Testing Clevis—A loading clevis suitable for testing disk-shaped compact specimens is shown in Fig. A6.2. Both ends of the specimen are held in such a clevis and conded through pins in order to allow rotation of the occimen during testing. In order to provide rolling contact towen the loading pins and clevis holes, these holes are provided with small flats on the loading surfaces (4). Other the designs may be used if it can be demonstrated that they will accomplish the same result as the design shown.

46.3.1.1 The critical tolerances and suggested proportions  $\ell$  the clevis and pins are given in Fig. A6.2. These reportions are based on specimens having W/B = 2 for B > 5 in. (12.7 mm) and W/B = 4 for  $B \le 0.5$  in. (12.7 mm). If 280 000-psi (1930-MPa) yield strength maraging steel is 3sed for the clevis and pins, adequate strength will be retained for testing the specimen sizes and  $\sigma_{YS}/E$  ratios 3sec in 7.1.3. If lower-strength grip material is used, or if 3stantially larger specimens are required at a given  $\sigma_{YS}/E$ 

ratio than those shown in 7.1.3, then heavier grips will be required. As indicated in Fig. A6.2 the clevis corners may be cut off sufficiently to accommodate seating of the clip gage in specimens less than 0.375 in. (9.5 mm) thick.

A6.3.1.2 Careful attention should be given to achieving as good alignment as possible through careful machining of all auxiliary gripping fixtures.


A6.3.2 Displacement Gage—For generally applicable details concerning the displacement gage see 6.3. For the disk-shaped compact specimen the displacements will be essentially independent of the gage length up to  $0.55 \ W$ .

### A6.4 Procedure

A6.4.1 *Measurement*—The analysis assumes the specimen was machined from a circular blank and therefore measurements of circularity as well as width, W, and crack length, a, must be made for this specimen.

A6.4.1.1 The specimen blank should be checked for circularity before specimen machining. Measure the radius at eight equally spaced points around the circumference of the specimen blank. One of these points should lie in the intended notch plane. Average these readings to obtain the radius, r. If any measurement differs from r by more than 5 %, machine the blank to the required circularity. Otherwise, D = 2r = 1.35 W.

A6.4.1.2 Measure the width, W, and the crack length, a, from the plane of the centerline of the loading holes (the notched edge is a convenient reference line but the distance from the centerline of the holes to the notched edge must be subtracted to determine W and a). Measure the depth, W, to the nearest 0.001 in. (0.025 mm) or 0.1 %, whichever is larger, at not less than three positions near the notch

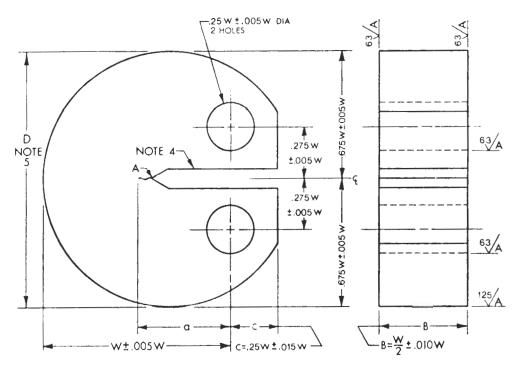

Note 1-A surfaces shall be perpendicular and parallel as applicable to within 0.002 W TIR.

Note 2—The intersection of the crack starter notch tips on each surface of the specimen shall be equally distant within 0.005 W from the centerline of the loading holes

NOTE 3—Integral or attachable knife edges for clip gage attachment to the crack mouth may be used (see Figs. 5 and 6).

Note 4-For starter notch and fatigue crack configuration see Fig. 7.

Note 5-For circularity requirements, see A6.4.1.1.

FIG. A6.1 Disk-Shaped Compact Specimen DC(T) Standard Proportions and Tolerances

location, and record the average value.

A6.4.1.3 For general requirements concerning specimen measurement see 8.2.

A6.4.2 Disk-Shaped Compact Specimen Testing—When assembling the loading train (clevises and their attachments to the tension machine) care should be taken to minimize eccentricity of loading due to misalignments external to the clevises. To obtain satisfactory alignment keep the centerline of the upper and lower loading rods coincident within 0.03 in. (0.76 mm) during the test and center the specimen with respect to the clevis opening within 0.03 in. (0.76 mm).

A6.4.2.1 Load the disk-shaped compact specimen at such a rate that the rate of increase of stress intensity is within the range 30 to 150 ksi·in.  $^{1/2}$ /min (0.55 to 2.75 MPa·m<sup>1/2</sup>/s), corresponding to a loading rate for a standard (W/B = 2) 1-in. thick specimen of 4500 to 22 500 lbf/min (0.34 to 1.7 kN/s), respectively.

A6.4.2.2 For details concerning recording of the test record see 8.4.

# A6.5 Calculations

25.75%

A6.5.1 For general requirements and procedures in interpretation of the test record see 9.1.

A6.5.2 For a description of validity requirements in terms of limitations on  $P_{\rm max}/P_Q$  and the specimen size requirements see 9.1.2 and 9.1.3.

A6.5.3 Calculation of  $K_Q$ —For the disk-shaped compact specimen calculate  $K_Q$  in units of ksi·in.<sup>1/2</sup> (MPa·m<sup>1/2</sup>) from the following expression (Note A6.1):

$$K_Q = (P_Q/BW^{1/2})f(a/W)$$

where:

$$f(a/W) = \frac{(2 + a/W)(0.76 + 4.8a/W - 11.58(a/W)^2 + 11.43(a/W)^3 - 4.08(a/W)^4}{(1 - a/W)^{3/2}}$$

where:

 $P_Q$  = load as determined in 9.1.1, klbf (kN),

B = specimen thickness as determined in 8.2.1, in. (cm).

W = specimen width as determined in A6.4.1.2, in. (cm<sup>1</sup>)


a = crack length as determined in 8.2.2 and A6.4.1.2, in (cm).

Note A6.1—This expression is considered accurate to within  $\pm 0.3^{-6}$  over the range of a/W from 0.2 to 1.0 (19).

A6.5.3.1 To facilitate calculation of  $K_Q$ , values of f(a/W) are tabulated in the following table for specific values of a/W:

•			
a/W	f(a/W)	a/W	f(a/W)
0.450	8.71	0.500	10. i 7
0.455	8.84	0.505	10.34
0.460	8.97	0.510	10.51
0.465	9.11	0.515	10.68
0.470	9.25	0.520	10.86
0.475	9.40	0.525	11.05
0.480	9.55	0.530	11.24
0.485	9.70	0.535	11.43
0.490	9.85	0.540	11.63
0.495	10.01	0.545	11.83
		0.550	12.04

A6.5.4 Calculation of R<sub>sdc</sub>—For the disk-shaped compact specimen calculate the specimen strength ratio (which

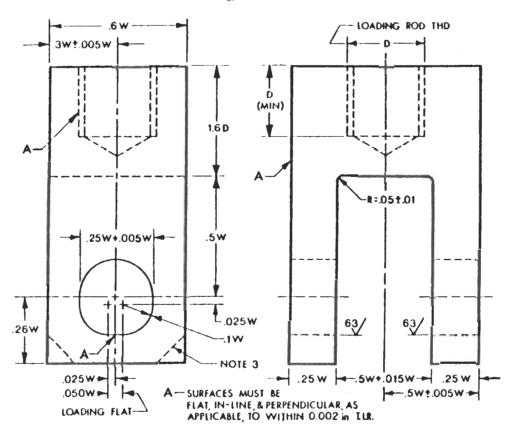

NOTE 1— Pin diameter = 0.24 W (+0.000 W/-0.005 W). For specimens with  $\sigma_{VS} > 200$  ksi (1379 MPa) the holes in the specimen and in the clevis may be 0.3 W  $_{\sim 0.005}^{\circ}$  W/-0.000 W) and the pin diameter 0.288 W (+0.000 W/-0.005 W).

NOTE 2-0.002 in. = 0.051 mm.

NOTE 3--Corners of the clevis may be removed if necessary to accommodate the clip gage.

FIG. A6.2 Tension Testing Clevis Design

dimensionless and has the same value in any consistent set of units) as follows:

$$R_{sdc} = \frac{2P_{\max}(2W + a)}{B(W - a)^2 \sigma_{YS}}$$

where:

 $P_{\text{max}}$  = maximum load that the specimen was able to sustain,

 $\theta$  = thickness of the specimen as determined in 8.2.1,

W = specimen width as determined in A6.4.1.2,

= crack length as determined in 8.2.2 and A6.4.1.2, and

 $\sigma_{YS}$  = yield strength in tension (offset = 0.2 %) (see Test Methods E 8).

A6.5.5 Calculation of Crack Mouth Opening Compliance Using Crack Length Measurements—For disk-shaped compact specimens, calculate the crack mouth opening compliance,  $V_m/P$ , in units of m/N (in./lb) as follows (see Note 46.2):

$$V_m/P = (1/E'B)q(a/W)$$

where:

$$A(a/W) = [19.75/(1 - a/W)^2][0.469 - 0.056(a/W) + 1.86(a/W)^2 - 2.06(a/W)^3 + 0.789(a/W)^4], \text{ and}$$

where:

 $V_m = \text{crack mouth opening displacement, m (in.)}$ 

P = applied load, kN (klbf).

= Effective Young's Modulus (= E for plane stress, Pa (psi); =  $E/(1 - v^2)$  for plane strain, Pa (psi),

 $\nu$  = Poisson's Ratio, and B, W, and a are as defined in A6.5.3.

Note A6.2—This expression is considered to be accurate to within  $\pm 1.0\%$  for  $a/W \ge 0.2$  (25). This expression is valid only for crack mouth displacements measured at the location of the integral knife edges shown in Fig. 5. If attachable knife edges are used, they must be reversed or inset to provide the same measurement point location.

A6.5.5.1 To facilitate the calculation of crack mouth opening compliances, values of q(a/W) are given in the following table for specific values of a/W:

a/W	q(a/W)	a/W	q(a/W)
0.450	43.4	0.500	55.1
0.455	44.4	0.505	56.5
0.460	45.5	0.510	57.9
0.465	46.6	0.515	59.4
0.470	47.7	0.520	60.9
0.475	48.8	0.525	62.5
0.480	50.0	0.530	64.1
0.485	51.2	0.535	65.8
0.490	52.5	0.540	67.6
0.495	53.8	0.545	69.4
		0.550	7.12

A6.5.6 For disk-shaped compact specimens, calculate the normalized crack length as follows (see Note A6.3):

$$a/W = 1.000 - 4.459U + 2.066U^2 - 13.041U^3$$

 $+ 167.627U^4 - 481.4U^5$ 

where:

$$U = 1/[1 + (E'BV_m/P)^{1/2}]$$

Note A6.3—This expression fits the equation in A6.5.5 within  $\pm 0.01$  % of W for  $a/W \le 0.2$  (25). This expression is valid only for crack mouth displacements measured at the location of the integral knife edges shown in Fig. 5. If attachable knife edges are used, they must be reversed or inset to provide the same measurement point location.

# A6.6 Precision and Bias (see also Section 11)

A6.6.1 There has been no round-robin test program for the disk-shaped specimen. However, the results of two testing programs (16) designed to compare the results of the disk-shaped specimen with those of the compact specimen and the arc-shaped specimen are summarized in Table A6.1. Based on the results in Table A6.1 and the geometric similarity of the specimens, there is no reason to suspect that the precision for the disk-shaped specimen would differ from

TABLE A6.1 Results of K<sub>kc</sub> Tests on Disk-Shaped Specimens, Compact Specimens, and Arc-Shaped Specimens

Labo	ratory 1	Labor	atory 2
Ni-Cr-Mo Steel $\sigma_{YS} = 1320 \text{ MPa}$ (192 ksi)		Ni-Cr-Mo Steel $\sigma_{YS} = 1290 \text{ MPa}$ (187 ksi)	
109.4 (99.5) 4.39 (3.99)	109.2 (99.4) 3.76 (3.42)	114.7 (104.4) 1.86 (1.69)	
	$Ni-Cr-l$ $\sigma_{YS} = 1$ (19 Disk 109.4 (99.5)	σ <sub>yS</sub> = 1320 MPa (192 ksi) Disk Arc 109.4 (99.5) 109.2 (99.4)	$ \begin{array}{c ccccc} Ni-Cr-Mo & Steel & Ni-Cr-Mo \\ \sigma_{YS} = 1320 & MPa & \sigma_{YS} = 1 \\ & & & & & & & & & & & & \\ \hline Disk & Arc & Disk & & & & & & \\ \hline 109.4 & (99.5) & 109.2 & (99.4) & 114.7 & (104.4) \\ \end{array} $

that for the compact specimen. The arc-tension specimen has been shown (18) to have essentially the same grand mean and standard deviation as the compact specimen.

NOTE A6.2—Units of mean and standard deviation are MPa m<sup>16</sup> (ks in. <sup>16</sup>).

# A7. SPECIAL REQUIREMENTS FOR RAPID-LOAD PLANE-STRAIN FRACTURE TOUGHNESS $K_{L'}(t)$ TESTING

# A7.1 Scope

A7.1.1 This annex covers the determination of plane-strain fracture toughness ( $K_{Ic}$ ) properties of metallic materials under conditions where the loading rates exceed those for conventional (static) testing [150 000 psi·in.<sup>1/2</sup>/min (2.75 MPa·m<sup>1/2</sup>/s)].

# A7.2 Summary of Requirements

A7.2.1 Special requirements are necessary for plane-strain fracture toughness testing at loading rates exceeding those of conventional (static) plane-strain fracture toughness testing. This description of these requirements does not include impact or quasi-impact testing (free-falling or swinging masses). Conventional fracture toughness test specimens are prepared as described in this method, tested under rapid-load conditions, and a fracture toughness value is calculated. Load-deflection, load-time, and deflection-time curves are recorded for each test. The load-deflection curves resulting from these tests are analyzed to ensure that the initial linear portion of the load-displacement record is sufficiently well defined that  $P_Q$  can be determined unambiguously. In addition, a test time (t), restricted to not less than one ms is determined. This test time and an optionally calculated average stress intensity factor rate K characterize the rapid load test. The yield strength of the material must be determined or estimated for the loading time of the fracture test and is used in the analysis of the fracture test data. All of the criteria for static  $K_{lc}$  determination apply to the rapidload plane-strain fracture toughness test. The rapid-load plane-strain fracture toughness property is denoted by  $K_{\rm lc}()$  where the time to reach the load corresponding to  $K_{\rm O}$ in ms is indicated in the brackets ( ).

# A7.3 Significance and Use

A7.3.1 The significance of the conventional (static)  $K_{lc}$  properties applies also to the case of rapid loading. The plane-strain fracture toughness of certain materials is sensitive to the loading rate and substantial decreases in toughness may be noted as the loading rate increases. Generally, such materials also show a pronounced dependence of  $K_{lc}$  on test temperature. For example, the loading rate sensitivity of structural grade steels has required the development of a

lower bound  $K_{IR}$  curve, given in Appendix G of Division III of the ASME Boiler and Pressure Vessel Code, for the fracture-safe design of heavy-wall nuclear pressure vessels Additionally,  $K_{Ic}$  values for steels tested at various temperatures and loading rates are required for correlation with small-scale production control tests (such as the Charpy V-notch test) for setting material specifications and fracture-safe design procedures.

# A7.4 Terminology

A7.4.1 Definitions:

A7.4.1.1 The definitions given in Terminology E 616 are applicable to this test method.

A7.4.1.2 Stress-Intensity Factor—See Section 5 of this test method.

A7.4.1.3 Plane-Strain Fracture Toughness—See Section 5 of this test method.

A7.4.1.4 Rapid Load—In fracture testing, any load that results in an average stress-intensity factor rate in excess of 150 000 psi in. 1/2/min (2.75 MPa·m¹/2/s);

A7.4.1.5 Stress-Intensity Factor Rate,  $K(FL^{-3/2}T^{-1})$ —In fracture testing, a change in stress-intensity factor, K, per unit time.

A7.4.1.6 Crack-Plane Orientation—See 5.1.3 of this test method.

A7.4.2 Description of Terms Specific to This Method:

A7.4.2.1 Rapid-Load Plane-Strain Fracture Toughness  $K_{\rm Lc}$  (FL<sup>-3/2</sup>)—The crack extension resistance under conditions of crack-tip plane strain at average loading rates exceeding 150 000 psi·in. \(^{1/2}\)/min (2.75 MPa·m\(^{1/2}\)/s). The time, t, to reach  $P_Q$ , in milliseconds is indicated in the brackets (t).

# A7.5 Apparatus

A7.5.1 Loading—Generally, hydraulic machines with rapid-acting servo controlled valves are used. Depending of the compliance of the loading system and the pump capacity an accumulator may be required.

A7.5.2 Fixtures—The fixtures used for static plane-strain fracture toughness tests are generally suitable for rapid-lost tests. However, consideration should be given to the possession of the

bity that the toughness of the fixture material may be educed by rapid loading.

A7.5.3 Load and Displacement Transducers—The transjucers used for static plane-strain fracture toughness tests are enerally suitable for rapid-load tests. However, these transnucers must have response characteristics that will ensure inertial effects will not contaminate the load and polacement signals.

NOTE A7.1—While not required, the resonant frequencies of these ansducers may be determined by suitably exciting them and observing wave characteristic on an oscilloscope. If ringing (high frequency is observed within the time period required to reach the  $P_Q$ bed, the stiffness of the transducers should be increased or their mass educed. Load cells are quite stiff and should provide no problem at the minimum loading time of 1 ms. The displacement transducer might be for concern depending on its design. The cantilever beam in Annex A1 has been used successfully at loading times slightly lower than 1 ms (20). The resonant frequency of his gage when mounted in a specimen in a conventional manner and excited by tapping is about 3300 Hz. The free-arm resonant frequency is about 750 Hz. Other gages of the same type but having different umensions should operate satisfactorily if their free arm resonance is at kast 750 Hz. The following equation may be used to estimate the free-arm resonant frequency of such a gage:

$$f = 0.162 \left[ \frac{b^2 Eg}{\rho l^4} \right]^{1/2}$$

shere:

= resonant frequency in hertz,

b = arm thickness in inches,

E = clastic modulus of the arms in pound-force per square inch,

= gravitational acceleration 386 in./s²,

= density of the arm material in pounds per cubic inch, and = length of the uniform thickness section of the arms in inches. The coefficient becomes 51.7 if SI units are used where b is in metres, E $_{\rm d}$  in megapascals, g is 9.804 m/s<sup>2</sup>,  $\rho$  is kilograms per cubic metres, and 1

A7.5.4 Signal Conditioners—Amplification or filtering of the transducer signals may be necessary. Such signal conditioning units should have a frequency response from dc to at least 20/t (kHz) where t is the test time in milliseconds as defined in A7.7.3. As described in A7.6.2, conventional mechanical recording devices may not have sufficient frequency response to permit direct plotting of the load versus time and the displacement versus time signals.

### A7.6 Procedure

A7.6.1 Loading Rate—The rate of loading is optional with the investigator but the time to reach the load corresponding to  $K_O$  shall not be less than 1 ms. Use a preload to eliminate ringing in the load or displacement transducers associated with clearances in the load train being suddenly taken up by the start of rapid loading.

A7.6.2 For each test conducted, a load versus time, a displacement versus time, and a load versus displacement record shall be obtained. The time scale of these records shall be accurately determined since the time is used to characterize the test. Examine the time-dependent records for the presence of ringing before reaching the  $P_O$  load. Such ringing can result from inertial effects as described in Note A7.1. The special record analysis procedure described in A7.7.3 may be helpful in assessing the magnitude of such effects.

Note A7.2—It should be recognized that some materials may exhibit a burst of crack extension at loads less than Po that is sufficiently abrupt to produce ringing in the displacement transducer signal. Such an

abrupt advance of the crack may be associated with material inhomogeneities local to the fatigue crack tip. If the ringing is severe it may not be possible to unambiguously determine a value for  $P_Q$ . The presence of such bursts of crack extension should be recorded for those tests having analyzable load versus displacement records.

Note A7.3—The test data may be directly recorded if the recording devices have sufficient frequency response. Generally, it is advantageous to use a storage device that will capture the data and permit playing it out at a sufficiently slow speed that a pen recorder can be used in producing the required records. Such storage devices are commonly available in the form of digital storage oscilloscopes having pen recorder outputs. Separate storage instruments are also available. In general these digital storage devices have performance characteristics that are more than adequate to capture, store, and replay the transducer signals from a 1 ms test. For example, calculations show that for a typical fracture test such as described in (20) the crack mouth displacement resolution would be about 0.030 mils/sample (0.76 μm/sample) and the load resolution would be about 160 lbf/sample (712 N/sample). It should be possible to obtain at least 1000 simultaneous samples of load and displacement during such a test. A digital storage scope capable of at least this performance would have the following characteristics: maximum digitizing rate 1 MHz, maximum sensitivity ±100 mV, resolution 0.025 %, and memory of 4096 words by 12 bits. It may be necessary to amplify the output of the clip gage moderately and possibly that of the load cell depending on its capacity in terms of the range required. The above values of resolution are based on a total noise figure of about 50 μV.

# A7.7 Calculation and Interpretation of Results

A7.7.1 Special requirements are placed on the analysis of the load versus displacement record. These take into account the fact that experience (20) has shown load versus displacement records from rapid-load fracture toughness tests are not always as smooth in the linear range as those obtained from static tests. The special requirements of this annex are designed to ensure that an unambiguous value of  $P_O$  can be

A7.7.1.1 The test time must be determined from the load versus time record.

A7.7.2 The additional analysis of the load versus displacement record is illustrated in Fig. A7.1. The procedure is as follows: Construct the straight line OA best representing the initial portion of the test record which ideally should be linear but may not be smooth (also see Note 6). Then construct the line OP<sub>5</sub> as described in 9.1.1 (Fig. 8) and determine  $P_O$ . Draw a vertical line at  $v_P$  passing through  $P_O$ and define P, at the point of intersection of this line with the line OA. Determine 5 % of  $P_{\nu}$  and construct two lines BC and DE parallel to OA with BC passing through  $P_v + 0.05 P_v$ and DE passing through  $P_Q$   $(P_v - 0.05 P_v)$ . Draw a horizontal line at  $P = 0.5 P_Q$ . For the test to be valid the recorded load versus displacement curve up to  $P_O$  must lie within the envelope described by these parallel lines for the portion of the record with  $P \ge 0.5 P_O$ .

A7.7.3 The test time t in milliseconds is determined from the record of load versus time as indicated in Fig. A7.2. Construct the best straight line OA through the most linear portion of the record. t is then determined from the point of intersection of this line with the time axis to the time corresponding to  $P_Q$ . This time t is shown in the brackets ) following  $K_{Ic}$ . An average stress intensity rate K may be calculated by dividing  $K_Q$  or  $K_{Ic}$  by t with the result being expressed in ksi·in.1/2/s or MPa·m1/2/s. It should be recognized that minor errors in determining the loading time are not significant because significant changes in the toughness

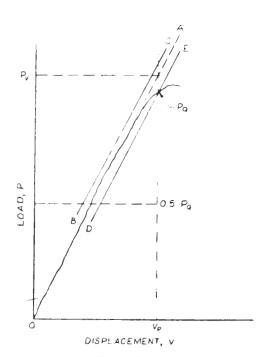


FIG. A7.1 Special Requirements for Analysis of Load Versus Displacement Records (5 % Secant Line Not Shown)

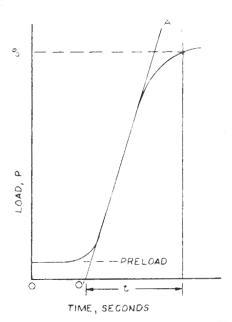


FIG. A7.2 Determination of Test Time From Load Versus Time Record

require a change of several orders of magnitude in loading rate.

A7.7.4 The 0.2 % offset tensile yield strength  $\sigma_{YS}$  is used in determining the specimen size requirements for a valid test as described in 9.1.3. If the rapid load value of  $K_Q$  is valid using a static yield strength value determined at a temperature at or above that of the rapid-load test, no further yield

strength considerations are necessary.

A7.7.5 If the test is invalid using such a yield strength, a tension test should be conducted on the test material at the temperature and loading time of the rapid-load toughness test with the time to reach the yield load in the tension test approximately equal to the time t defined in A7.7.3.

A7.7.6 In the absence of  $\sigma_{YD}$  values as defined in A7.7.5 the dynamic yield strength  $\sigma_{YD}$  of certain steels may be estimated using the following equations (21) (22):

$$\sigma_{\rm YD} = \sigma_{\rm YS} + \frac{A}{T_{\rm x} {\rm Log_{10}} (2 \times 10^7 t)} - B$$

where:

 $\sigma_{YS}$  = the 0.2 % offset room temperature static yield strength. t = the loading time in milliseconds (see A7.7.3), and  $T_x$  = the temperature of the rapid-load toughness test. Units:

If  $\sigma_{YS}$  is in pound force per square inch, then  $A = 174\,000$ .  $B = 27.2\,\mathrm{ksi}$ 

If  $\sigma_{YS}$  is in megapascals, then A = 1 198 860, B = 187.4 MPa If the test temperature T is measured in °F, then

$$T_x = (T + 460)$$

If the test temperature T is measured in K, then

$$T_x = 1.8 \times T$$

Note A7.4—The equation in A7.7.6 has been found useful only in estimating the low temperature dynamic yield strength of constructional steels having room temperature yield strengths below 70 ksi.

# A7.8 Report

A7.8.1 The report must include the following additional information:

A7.8.1.1 The test time written in ( ) after  $K_Q$  or  $K_{IC}$  A7.8.1.2 The method by which the value of  $\sigma_{YD}$  used in

A7.7.5 was obtained.

A7.8.1.3 Indications of ringing, that occur before  $P_Q$  is reached, in the load versus time or displacement versus time records.

# A7.9 Precision and Bias

A7.9.1 Bias—There is no accepted "standard" value for the plane-strain fracture toughness of any material. In the absence of such a true value, any statement concerning bias is not meaningful.

A7.9.2 Precision—Eighteen valid values of  $K_{\rm LC}(t)$  at -60% (-51%) were reported (20), with  $\sigma_{\rm YD}$  being determined by extrapolation of dynamic tensile yield strength values obtained at strain rates from 0.01 to 1.0/s and temperatures from room to -40%F. No statistical analysis of the dynamic tensile yield strength data was made. The rapid-load plane strain fracture toughness tests represented bend SE(B) and compact C(T) specimens tested in three thicknesses by seven laboratories. Not all laboratories tested all the thicknesses Statistical tests for outliers and for the differences between means indicated that the data should be pooled. Considering all the valid data the grand mean X = 55.64 ksi·in.  $^{1/2}$  (61.20 MPa·m $^{1/2}$ ), the standard deviation S = 7.90 ksi·in.  $^{1/2}$  (8.60 MPa·m $^{1/2}$ ) and the coefficient of variation is 14 % of the average.

# A8. SPECIAL REQUIREMENTS FOR THE TESTING OF BERYLLIUM

This annex describes the special requirements for ination of the plane strain fracture toughness of hot beryllium. With a few exceptions, the provisions of Method E 399 are applicable to the fracture toughness of beryllium. However, certain modifications to preparation and record analysis, as described in preparation and record analysis, as described in brittleness associated with cleavage fracture, high modulus, nonlinear elastic behavior in the hot-pressed modulus, and very high fatigue crack growth rates (26, 27).

A8.1—Inhalation of dust or fumes from metallic beryllium, oxide, or soluble beryllium compounds can result in systemic Machining and testing of beryllium require special precautions in industrial hygienist familiar with OSHA Standards should be maked before a beryllium test program is started.

# 1.1 Specimen Size, Configuration and Preparation

A8.2.1 Specimen Size—For hot-pressed material, the miner thickness shall be 13 mm (0.5 in.) or larger to excessive nonlinearity in the elastic portion of the addisplacement record.

A8.2.2 Specimen Configuration—The bend SE(B) or the compact C(T) specimen may be used. A straight through with (Fig. 7) shall be employed to provide sufficient fatigue—tak extension in the required reversed loading.

18,2.3 Specimen Preparation:

A8.2.3.1 Machining—Beryllium is not difficult to mathine, but machining damage is often encountered in eryllium and tensile specimens are sometimes etched to remove the damaged layer. However, experience has shown that such a procedure is not necessary in the preparation of beryllium fracture toughness specimens (27).

48.2.3.2 Fatigue Cracking-Fatigue cracking should be accomplished with a compression load 2 to 3 times that in tension (-3 < R < -2). The rate of fatigue crack growth will decrease with crack extension under this type of loading, and it will be necessary to increase the tension portion of the eycle to develop sufficiently long cracks. Generally that will require that the last 2.5 % of the crack growth be accomplished at greater than 60 % of the anticipated  $K_{Ic}$  value. To avoid breaking the specimen, values of  $K_{\rm MAX}$  greater than 80 % of the anticipated  $K_{\rm Ic}$  should not be used. As a guideline,  $K_{1c}$  at room temperature and in normal laboratory environments may be assumed to be between 10 and 11 MPa m<sup>1/2</sup> (9 and 10 ksi in. <sup>1/2</sup>). Fatigue crack progress should be followed on both sides of the specimen. It has proven helpful to use a dye solution (such as those used for penetrant inspection) to define the crack tips because the crack opening is relatively small for this high-modulus metal.

Fatigue cracking of compact specimens in tension-compression loading is especially difficult. Special gripping arrangements are required which are beyond the scope of this method. One such arrangement, however, is described in Ref (28).

Fatigue cracking of SE(B) specimens has been successfully accomplished in cantilever bending (26, 29). There the

expression for three-point bending given in A3.5 was used as a conservative approximation of  $K_f$  for the case of cantilever bending. A more recent approximation (30), obtained by curve-fitting the compliance calibration data in (7) for a cantilever bend specimen with L/W = 2, is

$$K_f = (PL/BW^{3/2})f(a/W)$$

where

where,  

$$f(a/W) = 0.326 + 30.318(a/W) - 59.905(a/W)^2 + 68.889(a/W)^3$$
, and

where:

P = maximum cyclic load, kN (klbf),

L = S/2 =one-half span, cm (in.), and

S, B, W, and a are as defined in A3.5.3 or A4.5.3.

Note A8.2—This expression is considered to be accurate to within  $\pm 5$  % for  $a/W \le 0.6$  (7).

To facilitate calculation of  $K_f$  for loading of SE(B) specimens in cantilever bending, values of f(a/W) are tabulated in the following table for specific values of a/W.

a/W	f(a/W)	a/W	f(a/W)
0.450	8.12	0.500	9.12
0.455	8.21	0.505	9.23
0.460	8.30	0.510	9.35
0.465	8.40	0.515	9.46
0.470	8.49	0.520	9.58
0.475	8.59	0.525	9.70
0.480	8.70	0.530	9.82
0.485	8.80	0.535	9.95
0.490	8.90	0.540	10.08
0.495	9.01	0.545	10.21
		0.550	10.34

When using cantilever bending, excessive clamping forces will produce cracks at the specimen edges which will invalidate the test.

### A8.3 Testing and Record Analyses

A8.3.1 Loads and displacements will be relatively low, and the production of a satisfactory test record will require high gain in the clip gage circuit. It is an advantage to use a relatively slow loading rate corresponding to about 0.18 MPa m<sup>1/2</sup>/s (10 ksi in. <sup>1/2</sup>/min) in order to provide an opportunity to unload the specimen if the recording gain controls are not adjusted to give the slope range specified by this method. When a nonlinear elastic portion of the load-displacement record is encountered, an initial slope should be established by drawing a straight line between two points on the load-deflection record, one point at 20 % of the maximum load and another at 80 % of maximum load.

# A8.4 Precision and Bias (see also Section 11)

A8.4.1 Hot pressed beryllium from two suppliers was tested in six laboratories in accordance with the procedures of this Annex with the following results:

	Batch I $\sigma_{yz} = 236.6 \text{ MPa}$ $(34.3 \text{ ksi})$	Batch 2 $\sigma_{yz} = 197.2 \text{ MPa}$ (28.6 ksi)
Grand mean, X	10.68 (9.72)	10.44 (9.50)
Standard deviation, S	0.93 (0.85)	0.78 (0.71)

Note A8.3—Units of grand mean and standard deviation are MPa  $m^{\nu_0}$  (ksi in.  $^{\nu_0})$ 

A8.4.2 The tensile elongation of beryllium depends on temperature and strain rate, but the magnitude of such

variability on  $K_{Ic}$  is not known. However, the results of the interlaboratory program (31) did not appear to be influenced by loading rates which varied from 0.20 to 2.7 MPa m<sup>1/2</sup>/s (1) to 143 ksi in. <sup>1/2</sup>/min).

# A9. SPECIAL REQUIREMENTS FOR TESTING ARC-SHAPED BEND SPECIMENS

### A9.1 Specimen

A9.1.1 The arc-shaped bend specimen (32) is a single-edge notched and fatigue cracked ring segment loaded in bending. The general proportions of the standard specimen are shown in Fig. A9.1. The value of the radius ratio  $r_1/r_2$  is limited to the range of 0.6 to 1.0 when the specimen is loaded with a span-to-width ratio S/W of 4, and from 0.4 to 1.0 when the specimen is loaded with a span-to-width ratio S/W of 3. For cylinders with radius ratios of less than these limits, the arc-shaped tension-loaded specimen or the disk-shaped specimen should be used.

A9.1.2 The arc-shaped bend specimen is intended to measure the fracture toughness so that the normal to the crack plane is in the circumferential direction and the direction of crack propagation is in the radial direction. This is the C-R orientation as defined in 5.1.3. For other orientations, a bend (Annex A3) or a compact (Annex A4) specimen should be used.

A9.1.3 Alternative specimens may have 2 < W/B < 4 but with no change in other proportions. The use of the alternative specimen proportions for the arc-shaped bend specimen can be advantageous because in many cases it is possible to test ring segments with no machining of the inner or outer radii, that is, with no change in W.

### A9.2 Specimen Preparation

A9.2.1 For generally applicable specifications concerning specimen size and preparation, see Section 7.

## A9.3 Apparatus


A9.3.1 Bend Test Fixture—The bend test fixture in

Annex A3 is suitable for the arc-shaped bend specimen as well.

A9.3.2 Displacement Gage—For generally applicable details concerning the displacement gage, see 6.3.

### A9.4 Procedure

A9.4.1 Measurement—Before testing an arc-shaped bend sample, measure  $(r_2 - r_1)$  to the nearest 0.025 mm (0.001 in.) or to 0.1 %, whichever is greater, at mid-thickness positions on both sides of and immediately adjacent to the crack starter notch mouth. Record the average of these two readings as W. Also measure  $(r_2 - r_1)$  at four positions, two as close as possible to the intersection of the inside radius and the machined flat surfaces, and two at approximately one half the circumferential distance between the machined flat surfaces and the crack plane. If any of these four measurements differ from W by more than 10 % discard or rework the specimen. Next, measure to the nearest 0.025 mm (0.00) in.) or to the nearest 0.1 %, whichever is greater, the distance in the crack plane between the chord that connects the two machined flat surfaces and the outer radius of the specimen This measurement should be on both sides of the specimen referencing each flat machined surface. Subtract W from the average of these two measurements and record the result as Z. Measure within 5 % the distance (g) across the crack mouth at the reference points for the measurement of the crack mouth opening displacement (For example, g = 0.25in. in Fig. 5). It should be noted that g may be equal to the notch width (N) or larger than N if machined knife edges are used. Measure within 5 % the outer radius,  $r_2$ ; if this is not possible, determine the average value of  $r_2$  as follows (see Note A9.1): Measure within 5 % the length, L, of the chord of the outer surface, that is, the chord established by the flat

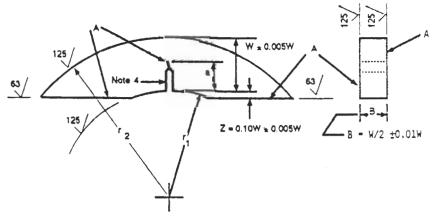

Note 1-A surfaces shall be perpendicular and parallel as applicable within 0.0001W TIR.

Note 2-Crack starter notch shall be perpendicular to specim@n surfaces to within ±2 degrees.

NOTE 3-Integral or attachable knife edges for clip gage attachment shall be used (see Figs. 5 and 6).

Note 4-For starter notch and fatigue crack configuration see Fig. 7.

FIG. A9.1 Arc-Shaped Bend Specimen A(B)—Standard Proportions and Tolerances

chined surfaces (see Fig. A9.2). Using this measurement, akulate

$$r_2 = [L^2/8(W+Z)] \cdot [(W+Z)/2]$$

 $r_1/r_2 = 1 - W/r_2.$ 


NOTE A9.1—A 10 % variation of the ratio  $r_1/r_2$  will affect the value stress intensity factor by 1.2 % or less providing that the relative length a/W is not less than 0.3. However, the stress analysis is on the assumption that the specimens are to be cut from stock of axisymmetric cross section. If inspection shows that the stock from axisymmetry by more than 10 % it should be reworked to within this tolerance.

A9.4.1.1 After fracture, measure the crack length in cordance with 8.2.2. An additional special procedure is accessary for the arc-shaped specimen due to its curvature. Thus a length measurement, m, made from a reference point ajacent to the crack mouth to a point on the crack front will greater than the corresponding distance from the virtual noint of intersection between the crack plane and the inside arcumference of the specimen (see Fig. A9.2). The error, e, may be computed from the following expression:

$$e = r_1 - (r_1^2 - g^2/4)^{1/2}$$

If the relative error e/m < 0.01, then record m as the crack  $e^{-igth}$ ; otherwise e should be subtracted from m and the rsult recorded as the crack length.

A9.4.2 Arc-Shaped Bend Specimen Testing-Set up the nest fixture such that the span, S, is nominally equal to four nmes (or three times) the width, W. Further adjust the

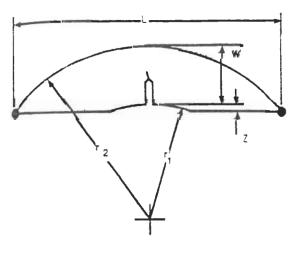

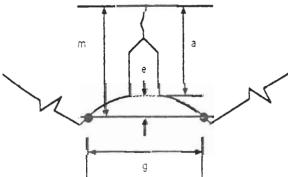


FIG. A9.2 Measurement of Outer Radius (r2) and Crack Length for the Arc-Shaped Bend Specimen (see A9.4.1.1)

fixture such that the line of action of the applied load shall pass midway between the support roll centers within 1 % of the distance between these centers. Measure the span to within 0.5 %. Locate the specimen with the crack tip midway between the rolls to within 1 % of the span and perpendicular to the roll axes within 2°. Seat the displacement gage on the knife edges to maintain registry between knife edges and gage grooves. In the case of attachable knife edges, seat the gage before the knife edge positioning screws are tightened.

A9.4.2.1 Load the specimen at a rate such that the rate of increase of the stress intensity factor is within the range 0.55 to 2.75 MPa m<sup>1/2</sup>/s (30 to 150 ksi in. <sup>1/2</sup>/min). The corresponding loading rates for a standard (W/B = 2) 25 mm (1 in.) thick specimen are between 0.3 and 2.4 kN/s (4500 and 32000 lbf/min) for the S = 3W specimen, and between 0.2 and 1.7 kN/s (3200 and 23000 lbf/min) for the S = 4Wspecimen.

A9.4.3 For details concerning the recording of the test record, see 8.4.

## A9.5 Calculations

A9.5.1 Interpretation of Test Record-For general requirements and procedures for interpretations of the test record, see 9.1.3.

A9.5.2 Validity Requirements—For a description of the validity requirements in terms of limitations on  $P_{\text{MAX}}/P_O$ and the specimen size requirements, see 9.1.2 through 9.1.3.

A9.5.3 Calculation of  $K_Q$ —For the arc-shaped bend specimen, calculate  $K_O$  in units of MPa m<sup>1/2</sup> (ksi in. <sup>1/2</sup>) as follows (Note A9.2):

For specimens with S = 4W:

$$K_Q = [P_Q S/BW^{3/2}][1 + (1 - r_1/r_2)h_1(a/W)] \cdot f_1(a/W)$$

where:

$$h_1(a/W) = 0.29 - 0.66(a/W) + 0.37(a/W)^2$$
, and  $f_1(a/W) = [0.677 + 1.078(a/W) - 1.43(a/W)^2 + 0.669(a/W)^3]/(1 - a/W)^{3/2}$ .

For specimens with S = 3W:

$$K_Q = [P_Q S/BW^{3/2}][1 + (1 - r_1/r_2)h_2(a/W)] \cdot f_2(a/W)$$

where:

$$h_2(a/W) = 0.20 - 0.32(a/W) + 0.12(a/W)^2,$$
  
 $f_2(a/W) = [0.644 + 1.11(a/W) - 1.49(a/W)^2 + 0.73(a/W)^3]/(1 - a/W)^{3/2},$  and

where:

P = load as determined in 9.1.1, kN (klbf),

B = specimen thickness as determined in 8.2.1, cm (in.),

S = span as determined in A9.4.2, cm (in.),

W = specimen depth (width) as determined in A9.4.1, cm (in.),

a = crack length as determined in 8.2.2, cm (in.),

 $r_1$  = inner radius as determined in A9.4.1, cm (in.), and

 $r_2$  = outer radius as determined in A9.4.1, cm (in.).

NOTE A9.2—These expressions are considered to be accurate to within  $\pm 1.0 \%$  for  $0.2 \le a/W \le 1.0$  and  $0.6 \le r_1/r_2 \le 1.0$  for S = 4W and within 1.5 % for  $0.2 \le a/W \le 1.0$  and  $0.4 \le r_1/r_2 \le 1.0$  for S = 3W(32).

A9.5.3.1 To facilitate calculation of K, values of f(a/W)are given in the following table for specific values of a/W:

a/W	$h_1(a/W)$	$f_1(a/W)$	$h_2(a/W)$	$f_2(a/W)$
0.450	0.0679	2.29	0.0803	2.23
0.455	0.0663	2.32	0.0792	2.26
0.460	0.0647	2.36	0.0782	2.29
0.465	0.0631	2.39	0.0771	2.33
0.470	0.0615	2.43	0.0761	2.36
0.475	0.0600	2.47	0.0751	2.40
0.480	0.0584	2.50	0.0740	2.44
0.485	0.0569	2.54	0.0730	2.48
0.490	0.0554	2.58	0.0720	2.52
0.495	0.0540	2,62	0.0710	2.55
0.500	0.0525	2.66	0.0700	2.60
0.505	0.0511	2.71	0.0690	2.64
0.510	0.0496	2.75	0.0680	2.68
0.515	0.0482	2.80	0.0670	2.72
0.520	0.0468	2.84	0.0660	2.77
0.525	0.0455	2.89	0.0651	2.82
0.530	0.0441	2.94	0.0641	2.86
0.535	0.0428	2.99	0.0631	2.91
0.540	0.0415	3.04	0.0622	2.96
0.545	0.0402	3.09	0.0612	3.01
0.550	0.0389	3.14	0.0603	3.06

#### REFERENCES

- Brown, W. F., Jr., and Srawley, J. E., "Plane Strain Crack Toughness Testing of High Strength Metallic Materials," ASTM STP 410, 1966.
- (2) Srawley, J. E.. "Plane Strain Fracture Toughness," Fracture, Vol 4, Ch. 2, p. 45-68.
- (3) "Fracture Toughness Testing and Its Applications," ASTM STP 381, April 1965.
- (4) Jones, M. H., Bubsey, R. T., and Brown, W. F., Jr., "Clevis Design for Compact Tension Specimens Used in K<sub>Ic</sub> Testing," Materials Research and Standards, ASTM, Vol 9, No. 5, May 1969.
- (5) Wessel, E. T., "State of the Art of the WOL Specimen for K<sub>Ic</sub> Fracture Toughness Testing," Engineering Fracture Mechanics, Vol 1, No. 1, January 1968.
- (6) Srawley, J. E., Jones, M. H., and Brown, W. F., Jr., "Determination of Plane Strain Fracture Toughness," Materials Research and Standards, ASTM, Vol 7, No. 6, June 1967, p. 262.
- (7) Fisher, D. M., and Repko, A. J., "Note on Inclination of Fatigue Cracks in Plane Strain Fracture Toughness Test Specimens," *Materials Research and Standards*, ASTM, Vol 9, No. 4, April 1969.
- (8) Heyer, R. H., and McCabe, D. E., "Evaluation of a Test Method for Plane-Strain Fracture Toughness Using a Bend Specimen," ASTM STP 463, 1970, p. 22.
- (9) McCabe, D. E., "Evaluation of the Compact Tension Specimen for Determining Plane-Strain Fracture Toughness of High Strength Materials," *Journal of Materials*, Vol 7, No. 4, December 1972, p. 449.
- (10) Fisher, D. M., Bubsey, R. T., and Srawley, J. E., "Design and Use of a Displacement Gage for Crack Extension Measurements," NASA TN-D-3724, Nat. Aeronautics and Space Administration, 1966.
- (11) Goode, R. J., "Identification of Fracture Plane Orientation," Materials Research and Standards, ASTM, Vol 12, No. 9, September 1972.
- (12) Srawley, J. E., "Wide Range Stress Intensity Factor Expressions for ASTM E 399 Standard Fracture Toughness Specimens," International Journal of Fracture Mechanics, Vol 12, June 1976, p. 475.
- (13) Newman, J. C., "Stress Analysis of Compact Specimens Including the Effects of Pin Loading," ASTM STP 560, 1974, p. 105.
- (14) Kapp, J. A., Newman, J. C., Jr., and Underwood, J. H., "A Wide Range Stress Intensity Factor Expression for the C-Shaped Specimen," *Journal of Testing and Evaluation*, Vol 8, No. 6, November 1980, pp. 314-317.

- (15) Jones, M. H., and Brown, W. F., Jr. "The Influence of Crack Length and Thickness in Plane Strain Fracture Toughness Tests." ASTM STP 463, 1970, p. 63.
- (16) Underwood, J. H., Newman, J. C., Jr., and Seeley, R. R., "A Proposed Standard Round Compact Specimen for Plane Strain Fracture Toughness Testing," *Journal of Testing and Evaluation*, Vol 8, No. 6, November 1980, p. 308-313.
- (17) McCabe, D. E. "Evaluation of the Compact Tension Specimen for Plane Strain Fracture Toughness of High Strength Materials. *Journal of Materials*, Vol 7, No. 4, December 1972, p. 449.
- (18) Underwood, J. H., and Kendall, D. P., "Cooperative Plane Strain Fracture Toughness Tests with C-Shaped Specimens," *Journal of Testing and Evaluation*, Vol 6, No. 5, September 1978, p. 296.
- (19) Newman, J. C., Jr., "Stress Intensity Factors and Crack Opening Displacements for Round Compact Specimens," *International Journal of Fracture*, Vol 17, No. 6, December 1981, pp. 567-578
- (20) Shoemaker, A. K., and Seeley, R. R., "Summary Report of Round-Robin Testing by the ASTM Task Group E24.01.06 of Rapid Loading Plane-Strain Fracture Toughness  $K_{Ic}$  Testing Journal of Testing and Evaluation, JTEVA Vol 11, No. 4, July 1983 pp. 261–272.
- (21) Madison, R. B., and Irwin, G. R., "Dynamic K<sub>c</sub> Testing of Structural Steel," *Journal of the Structural Division*, ASCE, Vol. 100, No. ST 7, Proceedings paper 10653, July 1974, p. 1331.
- (22) Irwin, G. R., Krafft, J. M., Paris, P., and Wells, A. A. "Basi: Aspects of Crack Growth and Fracture," NRL Report 6598, Nava Research Laboratory, November 1967.
- (23) Tada, H., Paris, P. C., and Irwin, G. R., "The Stress Analysis of Cracks Handbook," Del Research Corporation, Hellertown. PA 1973.
- (24) Wu, S. X., "Crack Length Calculation Formula for Three-Point Bend Specimens," *International Journal of Fracture*, Vol 24, 1984. pp. R33-R35.
- (25) Kapp, J. A., "Improved Wide Range Expressions for Displacements and Inverse Displacements for Standard Fracture Mechanis Specimens," Journal of Testing and Evaluation, JTEVA, Vol. 19. No. 1, January 1991, pp. 45-54.
- (26) Jones, M. H., Bubsey, R. T., and Brown, W. F. Jr., "Crack Toughness Evaluation of Hot Pressed and Forged Beryllium. Journal of Testing and Evaluation, JTEVA, Vol 1, No. 2. March 1973, pp. 100-109.
- (27) Lemon, D. D., and Brown, W. F., Jr., "Fracture Toughness of Hol Pressed Be," Journal of Testing and Evaluation, JTEVA, Vol No. 2, March 1985, p. 152.

Subbits, W. O., and Logsdon, W. A., "S-200 Grade Beryllium Fricture Toughness Properties," Journal of Testing and Evaluation, JTEVA, Vol 1, No. 2, March 1973, pp. 110–118.

Coarad, H., Sargent, G. A., and Brown, W. F., Jr., "A Joint Fricture Toughness Evaluation of Hot Pressed Beryllium," Beryllium Conference, The Royal Society, London, 1977, Paper 21.

Baratta, F. I., Private Communication, 21 Nov 1989. ASTM Research Report RR:E24–1015.

- (31) Conrad, H., and Sargent, G. A., "To Establish a Standard ASTM Method for Fracture Toughness Testing of Beryllium," NASA Grant NSG3013, Oct. 1977, ASTM Research Report No. RR:E24-1005.
- (32) Underwood, J. H., "Proposed Standard Arc-Bend Chord-Support Fracture Toughness Specimens and K Expressions," *Journal of Testing and Evaluation*, JTEVA, Vol 17, No. 4, July 1989, pp. 230-233.
- (33) Orange, T. W., "Some Effects of Experimental Error in Fracture Testing," Fracture Analysis, ASTM STP 560, 1974, pp. 122-133.

The American Society for Testing and Materials takes no position respecting the validity of any patent rights asserted in connection with any item mentioned in this standard. Users of this standard are expressly advised that determination of the validity of any such patent rights, and the risk of infringement of such rights, are entirely their own responsibility.

This standard is subject to revision at any time by the responsible technical committee and must be reviewed every five years and if not revised, either reapproved or withdrawn. Your comments are invited either for revision of this standard or for additional standards and should be addressed to ASTM Headquarters. Your comments will receive careful consideration at a meeting of the responsible technical committee, which you may attend. If you feel that your comments have not received a fair hearing you should make your views known to the ASTM Committee on Standards, 100 Barr Harbor Drive, West Conshohocken, PA 19428.